

# RESERVE ANALYSIS REPORT

## Sample Condominium Association

Escondido, California

Version 1

March 6, 2021



ADVANCED RESERVE SOLUTIONS, INC.

501 West Broadway, Suite 800

San Diego, California 92101

Phone (619) 695-4255

[www.arsinc.com](http://www.arsinc.com)

© 1997 - 2021

ADVANCED RESERVE SOLUTIONS, INC.

All Rights Reserved.

# Sample Condominium Association

## Table of Contents

	<b>Page</b>
Preface	i
Executive Summary	1
Membership Disclosure Summary	2
Calculation of Percent Funded	3
Management Summary	5
Management Charts	7
Annual Expenditure Detail	9
Projections	14
Projection Charts	15
Component Detail	17
Index	51

# Preface

This preface is intended to provide an introduction to the enclosed reserve analysis as well as detailed information regarding the reserve analysis report format, reserve fund goals/objectives and calculation methods. The following sections are included in this preface:

<b>Introduction to Reserve Budgeting</b> .....	page i
<b>Understanding the Reserve Analysis</b> .....	page i
<b>Reserve Funding Goals / Objectives</b> .....	page ii
<b>Reserve Funding Calculation Methods</b> .....	page ii
<b>Reading the Reserve Analysis</b> .....	page v
<b>Glossary of Key Terms</b> .....	page x
<b>Limitations of Reserve Analysis</b> .....	page xiii

## ◆ ◆ ◆ ◆ INTRODUCTION TO RESERVE BUDGETING ◆ ◆ ◆ ◆

The Board of Directors of an association has a legal and fiduciary duty to maintain the community in a good state of repair. Individual unit property values are significantly impacted by the level of maintenance and upkeep provided by the association as well as the amount of the regular assessment charged to each owner.

A prudent plan must be implemented to address the issues of long-range maintenance, repair and replacement of the common areas. Additionally, the plan should recognize that the value of each unit is affected by the amount of the regular assessment charged to each unit.

There is a fine line between “not enough,” “just right” and “too much.” Each member of an association should contribute to the reserve fund for their proportionate amount of “depreciation” (or “use”) of the reserve components. Through time, if each owner contributes his “fair share” into the reserve fund for the depreciation of the reserve components, then the possibility of large increases in regular assessments or special assessments will be minimized.

An accurate reserve analysis and a “healthy” reserve fund are essential to protect and maintain the association's common areas and the property values of the individual unit owners. A comprehensive reserve analysis is one of the most significant elements of any association's long-range plan and provides the critical link between sound business judgment and good fiscal planning. The reserve analysis provides a “financial blueprint” for the future of an association.

## ◆ ◆ ◆ ◆ UNDERSTANDING THE RESERVE ANALYSIS ◆ ◆ ◆ ◆

In order for the reserve analysis to be useful, it must be understandable by a variety of individuals. Board members (from seasoned, experienced Board members to new Board members), property managers, accountants, attorneys and even homeowners may ultimately review the reserve analysis. The reserve analysis must be detailed enough to provide a comprehensive analysis, yet simple enough to enable less experienced individuals to understand the results.

There are four key bits of information that a comprehensive reserve analysis should provide: Budget, Percent Funded, Projections and Inventory. This information is described as follows:

### **Budget**

Amount recommended to be transferred into the reserve account for the fiscal year for which the reserve analysis was prepared. In some cases, the reserve analysis may present two or more funding plans based on different goals/objectives. The Board should have a clear understanding of the differences among these funding goals/objectives prior to implementing one of them in the annual budget.

### **Percent Funded**

Measure of the reserve fund “health” (expressed as a percentage) as of the beginning of the fiscal year for which the

## Preface

reserve analysis was prepared. This figure is the ratio of the actual reserve fund on hand to the fully funded balance. A reserve fund that is “100% funded” means the association has accumulated the proportionately correct amount of money, to date, for the reserve components it maintains.

### **Projections**

Indicate the “level of service” the association will provide the membership as well as a “road map” for the fiscal future of the association. The projections define the timetables for repairs and replacements, such as when the buildings will be painted or when the asphalt will be seal coated. The projections also show the financial plan for the association – when an underfunded association will “catch up” or how a properly funded association will remain fiscally “healthy.”

### **Inventory**

Complete listing of the reserve components. Key bits of information are available for each reserve component, including placed-in-service date, useful life, remaining life, replacement year, quantity, current cost of replacement, future cost of replacement and analyst’s comments.

## ◆ ◆ ◆ ◆ RESERVE FUNDING GOALS / OBJECTIVES ◆ ◆ ◆ ◆

There are four reserve funding goals/objectives which may be used to develop a reserve funding plan that corresponds with the risk tolerance of the association: Full Funding, Baseline Funding, Threshold Funding and Statutory Funding. These goals/objectives are described as follows:

### **Full Funding**

Describes the goal/objective to have reserves on hand equivalent to the value of the deterioration of each reserve component. The objective of this funding goal is to achieve and/or maintain a 100% percent funded reserve fund. The component calculation method or cash flow calculation method is typically used to develop a full funding plan.

### **Baseline Funding**

Describes the goal/objective to have sufficient reserves on hand to never completely run out of money. The objective of this funding goal is to simply pay for all reserve expenses as they come due without regard to the association’s percent funded. The cash flow calculation method is typically used to develop a baseline funding plan.

### **Threshold Funding**

Describes the goal/objective other than the 100% level (full funding) or just staying cash-positive (baseline funding). This threshold goal/objective may be a specific percent funded target or a cash balance target. Threshold funding is often a value chosen between full funding and baseline funding. The cash flow calculation method is typically used to develop a threshold funding plan.

### **Statutory Funding**

Describes the pursuit of an objective as described or required by local laws or codes. The component calculation method or cash flow calculation method is typically used to develop a statutory funding plan.

## ◆ ◆ ◆ ◆ RESERVE FUNDING CALCULATION METHODS ◆ ◆ ◆ ◆

There are two funding methods which can be used to develop a reserve funding plan based on a reserve funding goal/objective: Component Calculation Method and Cash Flow Calculation Method. These calculation methods are described as follows:

### **Component Calculation Method**

This calculation method develops a funding plan for each individual reserve component. The sum of the funding plan for each component equals the total funding plan for the association. This method is often referred to as the “straight line”

## Preface

method and is widely believed to be the most conservative reserve funding method. This method structures a funding plan that enables the association to pay all reserve expenditures as they come due, enables the association to achieve the ideal level of reserves in time, and then enables the association to maintain the ideal level of reserves through time. The following is a detailed description of the component calculation method:

### Step 1: Calculation of fully funded balance for each component

The fully funded balance is calculated for each component based on its age, useful life and current cost. The actual formula is as follows:

$$\text{Fully Funded Balance} = \frac{\text{Age}}{\text{Useful Life}} \times \text{Current Cost}$$

### Step 2: Distribution of current reserve funds

The association's current reserve funds are assigned to (or distributed amongst) the reserve components based on each component's remaining life and fully funded balance as follows:

Pass 1: Components are organized in remaining life order, from least to greatest, and the current reserve funds are assigned to each component up to its fully funded balance, until reserves are exhausted.

Pass 2: If all components are assigned their fully funded balance and additional funds exist, they are assigned in a "second pass." Again, the components are organized in remaining life order, from least to greatest, and the remaining current reserve funds are assigned to each component up to its current cost, until reserves are exhausted.

Pass 3: If all components are assigned their current cost and additional funds exist, they are assigned in a "third pass." Components with a remaining life of zero years are assigned double their current cost.

Distributing, or assigning, the current reserve funds in this manner is the most efficient use of the funds on hand – it defers the make-up period of any underfunded reserves over the lives of the components with the largest remaining lives.

### Step 3: Developing a funding plan

After step 2, all components have a "starting" balance. A calculation is made to determine what funding would be required to get from the starting balance to the future cost over the number of years remaining until replacement. The funding plan incorporates the annual contribution increase parameter to develop a "stair stepped" contribution.

For example, if an association needs to accumulate \$100,000 in ten years, \$10,000 could be contributed each year. Alternatively, the association could contribute \$8,723 in the first year and increase the contribution by 3% each year thereafter until the tenth year.

In most cases, this rate should match the inflation parameter. Matching the annual contribution increase parameter to the inflation parameter indicates, in theory, that member contributions should increase at the same rate as the cost of living (inflation parameter). Due to the "time value of money," this creates the most equitable distribution of member contributions through time.

Using an annual contribution increase parameter that is greater than the inflation parameter will reduce the burden to the current membership at the expense of the future membership. Using an annual contribution increase parameter that is less than the inflation parameter will increase the burden to the current membership to the benefit of the future membership. The following chart shows a comparison:

## Preface

	<u>0% Increase</u>	<u>3% Increase</u>	<u>10% Increase</u>
Year 1	\$10,000.00	\$8,723.05	\$6,274.54
Year 2	\$10,000.00	\$8,984.74	\$6,901.99
Year 3	\$10,000.00	\$9,254.28	\$7,592.19
Year 4	\$10,000.00	\$9,531.91	\$8,351.41
Year 5	\$10,000.00	\$9,817.87	\$9,186.55
Year 6	\$10,000.00	\$10,112.41	\$10,105.21
Year 7	\$10,000.00	\$10,415.78	\$11,115.73
Year 8	\$10,000.00	\$10,728.25	\$12,227.30
Year 9	\$10,000.00	\$11,050.10	\$13,450.03
Year 10	\$10,000.00	\$11,381.60	\$14,795.04
TOTAL	<u>\$100,000.00</u>	<u>\$100,000.00</u>	<u>\$100,000.00</u>

This parameter is used to develop a funding plan only; it does not mean that the reserve contributions must be raised each year. There are far more significant factors that will contribute to a total reserve contribution increase or decrease from year to year than this parameter.

One of the major benefits of using this calculation method is that for any single component (or group of components), the accumulated balance and reserve funding can be precisely calculated. For example, using this calculation method, the reserve analysis can indicate the exact amount of current reserve funds “in the bank” for the roofs and the amount of money being funded towards the roofs each month. This information is displayed on the Management / Accounting Summary and Charts as well as elsewhere within the report.

The component calculation method is typically used for well-funded associations (greater than 65% funded) with a goal/objective of full funding.

### **Cash Flow Calculation Method**

This calculation method develops a funding plan based on current reserve funds and projected expenditures during a specific timeframe (typically 30 years). This funding method structures a funding plan that enables the association to pay for all reserve expenditures as they come due, but is not necessarily concerned with the ideal level of reserves through time.

This calculation method tests reserve contributions against reserve expenditures through time to determine the minimum contribution necessary (baseline funding) or some other defined goal/objective (full funding, threshold funding or statutory funding).

Unlike the component calculation method, this calculation method cannot precisely calculate the reserve funding for any single component (or group of components). In order to work-around this issue to provide this bookkeeping information, a formula has been applied to component method results to calculate a reasonable breakdown. This information is displayed on the Management / Accounting Summary and Charts as well as elsewhere within the report.

The cash flow calculation method is typically used for under-funded associations (less than 65% funded) with a goal/objective of full funding, threshold funding, baseline funding or statutory funding.

# Preface

## ◆ ◆ ◆ ◆ READING THE RESERVE ANALYSIS ◆ ◆ ◆ ◆

In some cases, the reserve analysis may be a lengthy document of one hundred pages or more. A complete and thorough review of the reserve analysis is always a good idea. However, if time is limited, it is suggested that a thorough review of the summary pages be made. If a “red flag” is raised in this review, the reader should then check the detail information, of the component in question, for all relevant information. In this section, a description of most of the summary or report sections is provided along with comments regarding what to look for and how to use each section.

### Executive Summary

Provides general information about the client, global parameters used in the calculation of the reserve analysis as well as the core results of the reserve analysis.

**Client Information**  
Provides various client information including fiscal year for which the reserve analysis was prepared, number of units, phasing, etc.

**Global Parameters**  
Displays the calculation parameters that were used to calculate the reserve analysis including inflation, annual contribution increase, investment rate, tax rate and contingency.

**Community Profile**  
Provides brief description of the community, as well as other “global” type comments.

**Budget**  
Provides recommended funding for the fiscal year for which the reserve analysis was prepared. Indicates the reserve funding from the membership, anticipated interest contribution and the total contribution

**Sample Homeowners Association**  
Executive Summary  
Component Calculation Method

Client Information:		Global Parameters:	
Account Number	00000	Inflation Rate	2.00%
Version Number	1	Annual Contribution Increase	2.00%
Analysis Date	3/18/2014	Investment Rate	1.00%
Fiscal Year	6/1/2014 to 5/31/2015	Taxes on Investment	30.00%
Number of Units	167	Contingency	3.00%
Phasing	8 of 8		

**Community Profile:**  
This community consists of 167 attached units with private roadways, pool area and extensive landscaped areas. For budgeting purposes, unless otherwise indicated, we have used June 1995 as the average placed-in-service date for aging the original components in this community.  
ARS site visits: March 1, 2014; January 2011; February 2009; April 2006; March 2005; March 2003; March 2002; April 2001 and March 2000

**Adequacy of Reserves as of June 1, 2014:**

Anticipated Reserve Balance	\$860,450.00
Fully Funded Reserve Balance	\$1,011,228.83
Percent Funded	85.08%

**Recommended Funding for the 2014-2015 Fiscal Year:**

	Annual	Monthly	Per Unit Per Month
Member Contribution	\$110,659	\$9,221.58	\$55.22
Interest Contribution	\$5,977	\$498.09	\$2.98
Total Contribution	\$116,636	\$9,719.66	\$58.20

3.18.2014(1) 1 ADVANCED RESERVE SOLUTIONS, INC.

**Adequacy of Reserves**  
Displays the results of calculations with regard to the “health” of the reserve fund as of the beginning of the fiscal year for which the reserve analysis was prepared. Provides the anticipated reserve balance, fully funded reserve balance and the percent funded.

# Preface

## Calculation of Percent Funded

Summary displays all reserve components, shown here in “category” order. Provides the remaining life, useful life, current cost and the fully funded balance at the beginning of the fiscal year for which the reserve analysis was prepared.

### Reserve Components

All components are displayed (shown here in “category” order).

### Lifespans

Remaining life and useful life are displayed. And, these columns are conveniently sub totaled to show range.

**Sample Homeowners Association  
Calculation of Percent Funded  
Sorted by Category**

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
<b>010 Streets</b>				
Streets - Asphalt, Overlay / Major Rehab	8	27	\$101,667.50	\$71,564.91
Streets - Asphalt, Repair	0	4	\$3,621.75	\$3,621.75
Streets - Asphalt, Seal Coat	0	4	\$5,926.50	\$5,926.50
Streets - Concrete, Unfunded	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>0-8</b>	<b>4-27</b>	<b>\$111,245.75</b>	<b>\$81,113.16</b>
<b>020 Roofs</b>				
Roofs - Tile				
<b>Sub Total</b>				
<b>030 Painting</b>				
Painting - Cabana Interior				
Painting - Red Curbs				
Painting - Stucco				
Painting - Woodwork & Trim				
Painting - Wrought Iron, Buildings				
Painting - Wrought Iron, Pool Area				
<b>Sub Total</b>				
<b>040 Fencing</b>				
Fencing - Wrought Iron, Pool Area				
Railing - Wrought Iron, Buildings				
<b>Sub Total</b>				
<b>050 Lighting</b>				
Lighting - Buildings				
Lighting - Grounds				
<b>Sub Total</b>				
<b>060 Pool Area</b>				
Cabana - Ceramic Tile				
Cabana - Doors				
Cabana - Plumbing Fixtures				
Cabana - Restroom Partitions				
Cabana - Water Heater				
Pool - Filter				
Pool - Heater				
Pool - Replaster & Tile Replace				
Pool Area - Barbecues				
<b>Sub Total</b>				
3.18.2014(1)				

**Sample Homeowners Association  
Calculation of Percent Funded  
Sorted by Category**

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
Pool Area - Ceramic Tile	2	21	\$8,501.63	\$7,773.38
Pool Area - Concrete Deck, Unfunded	n.a.	n.a.	\$0.00	\$0.00
Pool Area - Furniture (Refurbish)	0	12	\$9,255.00	\$9,255.00
Pool Area - Furniture (Replace)	6	25	\$17,315.00	\$13,159.40
Pool Area - Mastic	0	4	\$5,131.50	\$5,131.50
Spa - Filter	0	13	\$1,350.00	\$1,350.00
Spa - Heater	0	10	\$3,050.00	\$3,050.00
Spa - Replaster & Tile Replace	3	8	\$5,250.00	\$3,126.40
<b>Sub Total</b>	<b>0-6</b>	<b>4-25</b>	<b>\$91,747.38</b>	<b>\$71,964.53</b>
<b>070 Decks</b>				
Decks - Clean & Top Coat	2	5	\$30,480.00	\$18,288.00
Decks - Resurface	2	13	\$65,227.20	\$54,720.81
<b>Sub Total</b>	<b>2</b>	<b>5-13</b>	<b>\$95,707.20</b>	<b>\$73,008.81</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	2	21	\$27,625.00	\$24,994.05
Utility Closet Doors	2	21	\$73,900.00	\$69,801.90
<b>Sub Total</b>	<b>2</b>	<b>21</b>	<b>\$101,525.00</b>	<b>\$94,855.95</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	0	12	\$20,000.00	\$20,000.00
Landscape - Renovation, Unfunded	n.a.	n.a.	\$0.00	\$0.00
Mailboxes	2	21	\$37,200.00	\$33,657.14
<b>Sub Total</b>	<b>0-2</b>	<b>12-21</b>	<b>\$66,200.00</b>	<b>\$62,657.14</b>
<b>100 Termite Control</b>				
Termite Control	n.a.	n.a.	\$0.00	\$100,000.00
<b>Sub Total</b>	<b>n.a.</b>	<b>n.a.</b>	<b>\$0.00</b>	<b>\$100,000.00</b>
Contingency	n.a.	n.a.	n.a.	\$20,453.27
<b>Total</b>	<b>0-11</b>	<b>2-30</b>	<b>\$1,091,533.70</b>	<b>\$1,011,228.83</b>
<b>Anticipated Reserve Balance</b>				<b>\$865,456.00</b>
<b>Percent Funded</b>				<b>85.58%</b>
3.18.2014(1)				

### Current Cost

Displays the current cost to replace or otherwise maintain each component. This column is conveniently sub totaled.

### Fully Funded Balance

Displays the fully funded balance for each component. This column is conveniently sub totaled.

The total current cost to replace or otherwise maintain all components, total fully funded balance, anticipated reserve balance and percent funded are provided at the bottom of this summary. Also shown is the range of reserve component remaining lives and useful lives.



# Preface

## Management / Accounting Summary and Charts

Summary displays all reserve components, shown here in “category” order. Provides the assigned reserve funds at the beginning of the fiscal year for which the reserve analysis was prepared along with the monthly member contribution, interest contribution and total contribution for each component and category. Pie charts show graphically how the total reserve fund is distributed amongst the reserve component categories and how each category is funded on a monthly basis.

**Balance at FYB**  
Shows the amount of reserve funds assigned to each reserve component. And, this column is conveniently sub totaled.


**Sample Homeowners Association**  
Management / Accounting Summary  
Component Calculation Method; Sorted by Category

	Balance at Fiscal Year Beginning	Monthly Member Contribution	Monthly Interest Contribution	Total Monthly Contribution
<b>010 Streets</b>				
Streets - Asphalt, Overlay / Major Rehab	\$17,837.90	\$949.09	\$13.37	\$963.07
Streets - Asphalt, Repair	\$3,821.75	\$78.20	\$0.25	\$78.45
Streets - Asphalt, Seal Coat	\$5,928.50	\$127.96	\$0.41	\$128.37
Streets - Concrete, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$27,588.15</b>	<b>\$1,155.84</b>	<b>\$14.04</b>	<b>\$1,169.88</b>
<b>020 Roofs</b>				
Roofs - Tile				
<b>Sub Total</b>				
<b>030 Painting</b>				
Painting - Cabana Interior				
Painting - Red Curbs				
Painting - Stucco				
Painting - Woodwork & Trim				
Painting - Wrought Iron, Buildings				
Painting - Wrought Iron, Pool Area				
<b>Sub Total</b>				
<b>040 Fencing</b>				
Fencing - Wrought Iron, Pool Area				
Railing - Wrought Iron, Buildings				
<b>Sub Total</b>				
<b>050 Lighting</b>				
Lighting - Buildings				
Lighting - Grounds				
<b>Sub Total</b>				
<b>060 Pool Area</b>				
Cabana - Ceramic Tile				
Cabana - Doors				
Cabana - Plumbing Fixtures				
Cabana - Restroom Partitions				
Cabana - Water Heater				
Pool - Filter				
<b>Sub Total</b>				
<b>070 Decks</b>				
Decks - Clean & Top Coat	\$18,288.00	\$539.52	\$12.44	\$551.96
Decks - Resurfacing	\$94,720.81	\$306.93	\$33.65	\$340.58
<b>Sub Total</b>	<b>\$113,008.81</b>	<b>\$846.45</b>	<b>\$46.09</b>	<b>\$892.54</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	\$24,994.05	\$139.11	\$15.07	\$154.19
Utility Closet Doors	\$95,881.90	\$372.15	\$40.32	\$412.47
<b>Sub Total</b>	<b>\$120,875.95</b>	<b>\$511.26</b>	<b>\$55.40</b>	<b>\$566.66</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	\$20,000.00	\$219.48	\$0.71	\$220.19
Landscape - Renovation, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Mailboxes	\$33,657.14	\$187.33	\$20.30	\$207.63
<b>Sub Total</b>	<b>\$53,657.14</b>	<b>\$406.82</b>	<b>\$21.00</b>	<b>\$427.82</b>
<b>100 Termite Control</b>				
Termite Control	\$100,000.00	\$0.00	\$58.52	\$58.52
<b>Sub Total</b>	<b>\$100,000.00</b>	<b>\$0.00</b>	<b>\$58.52</b>	<b>\$58.52</b>
Contingency	\$25,207.28	\$268.59	\$15.61	\$284.20
<b>Total</b>	<b>\$865,450.00</b>	<b>\$9,221.58</b>	<b>\$498.09</b>	<b>\$9,719.66</b>


**Monthly Funding**  
Displays the monthly funding for each component from the members and interest. Total monthly funding is also indicated. And, these columns are conveniently sub totaled.

**Sample Homeowners Association**  
Management / Accounting Summary  
Component Calculation Method; Sorted by Category

	Balance at Fiscal Year Beginning	Monthly Member Contribution	Monthly Interest Contribution	Total Monthly Contribution
Pool - Heater	\$3,250.00	\$24.00	\$0.08	\$24.08
Pool - Replaster & Tile Replace	\$7,070.58	\$146.76	\$4.61	\$151.37
Pool Area - Barbecues	\$1,010.00	\$26.98	\$0.69	\$27.67
Pool Area - Ceramic Tile	\$7,773.38	\$43.27	\$4.69	\$47.96
Pool Area - Concrete Deck, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Pool Area - Furniture (Refurbish)	\$9,255.00	\$70.05	\$0.23	\$70.27
Pool Area - Furniture (Replace)	\$13,159.40	\$74.78	\$7.94	\$82.70
Pool Area - Mastic	\$5,131.50	\$110.79	\$0.36	\$111.15
Spa - Filter	\$1,350.00	\$12.11	\$0.04	\$12.15
Spa - Heater	\$2,000.00	\$27.36	\$0.09	\$27.44
Spa - Replaster & Tile Replace	\$3,128.40	\$94.12	\$2.04	\$96.15
<b>Sub Total</b>	<b>\$71,964.53</b>	<b>\$716.19</b>	<b>\$30.10</b>	<b>\$746.28</b>
<b>070 Decks</b>				
Decks - Clean & Top Coat	\$18,288.00	\$539.52	\$12.44	\$551.96
Decks - Resurfacing	\$94,720.81	\$306.93	\$33.65	\$340.58
<b>Sub Total</b>	<b>\$113,008.81</b>	<b>\$846.45</b>	<b>\$46.09</b>	<b>\$892.54</b>
<b>080 Misc (Buildings)</b>				
Fire Extinguisher Cabinets	\$24,994.05	\$139.11	\$15.07	\$154.19
Utility Closet Doors	\$95,881.90	\$372.15	\$40.32	\$412.47
<b>Sub Total</b>	<b>\$120,875.95</b>	<b>\$511.26</b>	<b>\$55.40</b>	<b>\$566.66</b>
<b>090 Misc (Grounds)</b>				
Landscape - Irrigation Controllers	\$20,000.00	\$219.48	\$0.71	\$220.19
Landscape - Renovation, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Mailboxes	\$33,657.14	\$187.33	\$20.30	\$207.63
<b>Sub Total</b>	<b>\$53,657.14</b>	<b>\$406.82</b>	<b>\$21.00</b>	<b>\$427.82</b>
<b>100 Termite Control</b>				
Termite Control	\$100,000.00	\$0.00	\$58.52	\$58.52
<b>Sub Total</b>	<b>\$100,000.00</b>	<b>\$0.00</b>	<b>\$58.52</b>	<b>\$58.52</b>
Contingency	\$25,207.28	\$268.59	\$15.61	\$284.20
<b>Total</b>	<b>\$865,450.00</b>	<b>\$9,221.58</b>	<b>\$498.09</b>	<b>\$9,719.66</b>

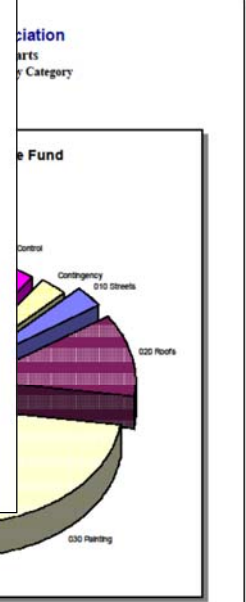

**Pie Charts**  
Show graphically how the reserve fund is distributed amongst the reserve components and how the components are funded.

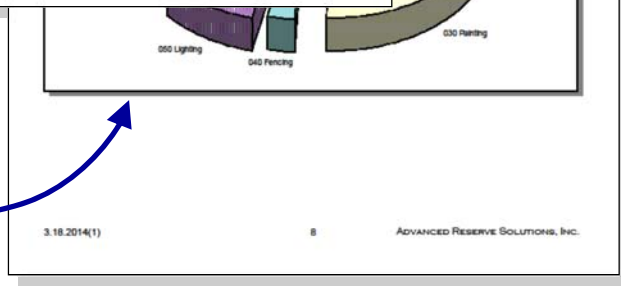

# Preface

## Projections and Charts

Summary displays projections of beginning reserve balance, member contribution, interest contribution, expenditures and ending reserve balance for each year of the projection period (shown here for 30 years). The two columns on the right-hand side provide the fully funded ending balance and the percent funded for each year. Charts show the same information in an easy-to-understand graphic format.

**Sample Homeowners Association  
Projections  
Component Calculation Method**



Fiscal Year	Beginning Balance	Member Contribution	Interest Contribution	Expenditures	Ending Balance	Fully Funded Ending Balance	Percent Funded
2014-2015	\$865,450	\$110,659	\$5,977	\$54,980	\$917,106	\$1,046,139	88%
2015-2016	\$917,106	\$111,857	\$6,482	\$45,317	\$990,127	\$1,104,098	90%
2016-2017	\$990,127	\$116,806	\$3,175	\$591,549	\$518,559	\$598,939	87%
2017-2018	\$518,559	\$115,807	\$3,900	\$7,715	\$630,610	\$698,915	90%
2018-2019	\$630,610	\$116,508	\$4,431	\$52,973	\$998,577	\$755,512	94%
2019-2020	\$998,577	\$116,723	\$5,037	\$34,701	\$785,576	\$834,243	94%
2020-2021	\$785,576	\$118,645	\$5,331	\$80,731	\$828,821	\$896,179	92%
2021-2022	\$828,821	\$121,028	\$5,925	\$40,530	\$915,241	\$949,147	96%
2022-2023	\$915,241	\$123,506					
2023-2024	\$907,080	\$125,898					
2024-2025	\$1,037,322	\$126,436					
2025-2026	\$825,894	\$127,755					
2026-2027	\$780,089	\$125,648					
2027-2028	\$713,358	\$119,373					
2028-2029	\$631,867	\$131,699					
2029-2030	\$696,194	\$131,038					
2030-2031	\$1,013,798	\$137,575					
2031-2032	\$1,130,018	\$141,510					
2032-2033	\$1,237,543	\$143,162					
2033-2034	\$973,396	\$138,561					
2034-2035	\$1,104,489	\$147,134					
2035-2036	\$1,222,996	\$149,242					
2036-2037	\$1,317,743	\$150,808					
2037-2038	\$926,826	\$142,178					
2038-2039	\$1,078,992	\$157,813					
2039-2040	\$1,102,377	\$157,111					
2040-2041	\$1,234,862	\$165,390					
2041-2042	\$952,393	\$161,588					
2042-2043	\$1,056,301	\$171,747					
2043-2044	\$1,200,105	\$169,299					

NOTE: In some cases, the projected Ending Balance Expenditures. This is a result of the provision of contingency is continually adjusted according to

3.18.2014(1)

Improved format makes the numbers as easy to read and understand as possible. The color-coded bar indicates the reserve fund status:

Green: Good  
Yellow: Fair  
Red: Poor

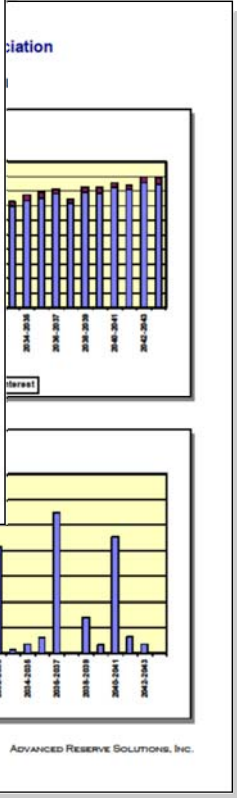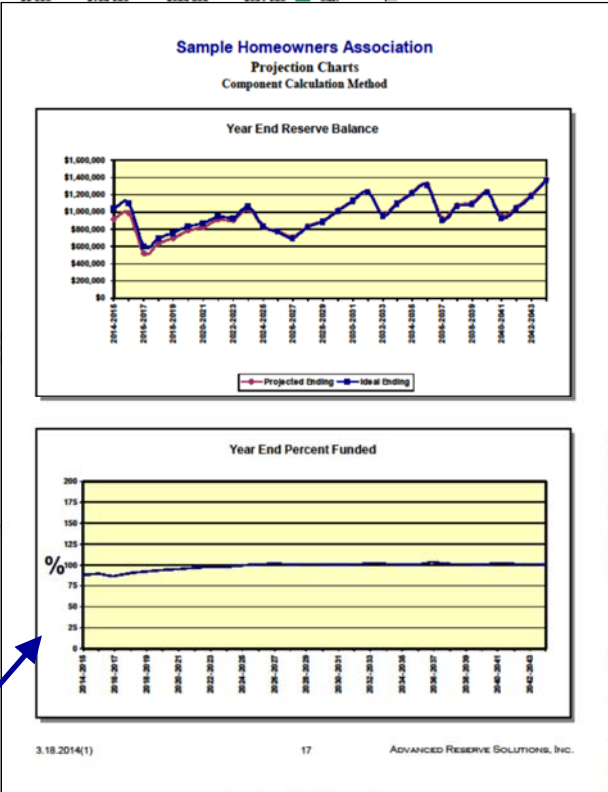

**Charts**  
Show graphically the reserve funding plan through time.

# Preface

## Component Detail

Summary provides detailed information about each reserve component. These pages display all information about each reserve component as well as comments from site observations and historical information regarding replacement or other maintenance.

### Lifespan Information

Displays placed-in-service date, useful life, remaining life and replacement year.

### Cost Information

Displays quantity, unit cost, percentage of replacement, current cost and future cost.

### Calculation Results

Displays assigned reserves and funding requirements.

**Streets - Asphalt, Seal Coat**

Category	010 Streets	Quantity	65,850 sq. ft.
Photo Date	January 2011	Unit Cost	\$0.090
		% of Replacement	100.00%
		Current Cost	\$5,926.50
		Future Cost	\$6,415.03
Placed In Service	11/09	Assigned Reserves at FYB	\$5,926.50
Useful Life	4	Monthly Member Contribution	\$127.96
Remaining Life	0	Monthly Interest Contribution	\$0.41
Replacement Year	2014-2015	Total Monthly Contribution	\$128.37

**Painting - Woodwork & Trim**

Category	030 Painting	Quantity	31,575 sq. ft.
Photo Date	January 2011	Unit Cost	\$0.620
		% of Replacement	100.00%
		Current Cost	\$20,949.00
		Future Cost	\$30,222.58
Placed In Service	06/12	Assigned Reserves at FYB	\$14,524.50
Useful Life	4	Monthly Member Contribution	\$634.91
Remaining Life	2	Monthly Interest Contribution	\$10.54
Replacement Year	2016-2017	Total Monthly Contribution	\$645.45

**Pool - Replaster & Tile Replace**

Category	060 Pool Area	Quantity	1 pool
Photo Date	January 2011	Unit Cost	\$15,075.000
		% of Replacement	100.00%
		Current Cost	\$15,075.00
		Future Cost	\$16,644.02
Placed In Service	01/10	Assigned Reserves at FYB	\$7,070.58
Useful Life	10	Monthly Member Contribution	\$146.79
Remaining Life	5	Monthly Interest Contribution	\$4.61
Replacement Year	2019-2020	Total Monthly Contribution	\$151.37

**Comments**

The association seal coated and restriped the streets for a total cost of \$5,926.50. The association repaired, seal coated and restriped the streets for a total cost of \$5,926.50. The association seal coated and restriped the streets for a total cost of \$5,926.50.

The current cost used for this component is adjusted for inflation where applicable.

Asphalt surfaces should be seal coated on a regular basis.

3.18.2014(1)

The association painted the woodwork and trim for a total cost of \$20,949.00. The association painted the woodwork and trim for a total cost of \$20,949.00.

The current cost used for this component is adjusted for inflation where applicable.

For budgeting purposes, we have used the current cost.

The inventory for this component has been reviewed and we believe this inventory is accurate.

3.18.2014(1)

The pool and spa were replastered in March 2000 for a total cost of approximately \$6,700. The association washed the pool in June 2002 for a total cost of \$675. The association replastered the pool and spa (including replacement of the mastic directly adjacent to the pool and spa) in January 2010 for a total cost of \$15,000.

3.18.2014(1)

42 ADVANCED RESERVE SOLUTIONS, INC.

### Comments

Useful information from site observations and historical expenses included here.

### Photos

Optional inclusion of photos adds an additional layer of detail to the reserve analysis.

## Preface

### ◆ ◆ ◆ ◆ GLOSSARY OF KEY TERMS ◆ ◆ ◆ ◆

#### **Annual Contribution Increase Parameter**

The rate used in the calculation of the funding plan. This rate is used on an annual compounding basis. This rate represents, in theory, the rate the association expects to increase contributions each year.

In most cases, this rate should match the inflation parameter. Matching the annual contribution increase parameter to the inflation parameter indicates, in theory, that member contributions should increase at the same rate as the cost of living (inflation parameter). Due to the “time value of money,” this creates the most equitable distribution of member contributions through time.

This parameter is used to develop a funding plan only; it does not mean that the reserve contributions must be raised each year. There are far more significant factors that will contribute to a total reserve contribution increase or decrease from year to year than this parameter. See the description of “reserve funding calculation methods” in this preface for more detail on this parameter.

#### **Anticipated Reserve Balance (or Reserve Funds)**

The amount of money, as of a certain point in time, held by the association to be used for the repair or replacement of reserve components. This figure is “anticipated” because it is calculated based on the most current financial information available as of the analysis date, which is almost always prior to the fiscal year beginning date for which the reserve analysis is prepared.

#### **Assigned Funds (and “Fixed” Assigned Funds)**

The amount of money, as of the fiscal year beginning date for which the reserve analysis is prepared, that a reserve component has been assigned.

The assigned funds are considered “fixed” when the normal calculation process is bypassed and a specific amount of money is assigned to a reserve component. For example, if the normal calculation process assigns \$10,000 to the roofs, but the association would like to show \$20,000 assigned to roofs, “fixed” funds of \$20,000 can be assigned.

#### **Cash Flow Calculation Method**

Reserve funding calculation method developed based on total annual expenditures. A more detailed description of the actual calculation process is included in the “reserve funding calculation methods” section of the preface.

#### **Component Calculation Method**

Reserve funding calculation method developed based on each individual component. A more detailed description of the actual calculation process is included in the “reserve funding calculation methods” section of the preface.

#### **Contingency Parameter**

The rate used as a built-in buffer in the calculation of the funding plan. This rate will assign a percentage of the reserve funds, as of the fiscal year beginning, as contingency funds and will also determine the level of funding toward the contingency each month.

#### **Current Replacement Cost**

The amount of money, as of the fiscal year beginning date for which the reserve analysis is prepared, that a reserve component is expected to cost to replace.

#### **Fiscal Year**

Indicates the budget year for the association for which the reserve analysis was prepared. The fiscal year beginning (FYB) is the first day of the budget year; the fiscal year end (FYE) is the last day of the budget year.

#### **Fully Funded Reserve Balance (or Ideal Reserves)**

The amount of money that should theoretically have accumulated in the reserve fund as of a certain point in time. Fully funded reserves are calculated for each reserve component based on the current replacement cost, age and useful life:

## Preface

$$\text{Fully Funded Reserves} = \frac{\text{Age}}{\text{Useful Life}} \times \text{Current Replacement Cost}$$

The fully funded reserve balance is the sum of the fully funded reserves for each reserve component.

An association that has accumulated the fully funded reserve balance does not have all of the funds necessary to replace all of its reserve components immediately; it has the proportionately appropriate reserve funds for the reserve components it maintains, based on each component's current replacement cost, age and useful life.

### **Future Replacement Cost**

The amount of money, as of the fiscal year during which replacement of a reserve component is scheduled, that a reserve component is expected to cost to replace. This cost is calculated using the current replacement cost compounded annually by the inflation parameter.

### **Global Parameters**

The financial parameters used to calculate the reserve analysis. See also "inflation parameter," "annual contribution increase parameter," "investment rate parameter" and "taxes on investments parameter."

### **Inflation Parameter**

The rate used in the calculation of future costs for reserve components. This rate is used on an annual compounding basis. This rate represents the rate the association expects the cost of goods and services relating to their reserve components to increase each year.

### **Interest Contribution**

The amount of money contributed to the reserve fund by the interest earned on the reserve fund and member contributions.

### **Investment Rate Parameter**

The gross rate used in the calculation of interest contribution (interest earned) from the reserve balance and member contributions. This rate (net of the taxes on investments parameter) is used on a monthly compounding basis. This parameter represents the weighted average interest rate the association expects to earn on their reserve fund investments.

### **Membership Contribution**

The amount of money contributed to the reserve fund by the association's membership.

### **Monthly Contribution (and "Fixed" Monthly Contribution)**

The amount of money, for the fiscal year which the reserve analysis is prepared, that a reserve component will be funded.

The monthly contribution is considered "fixed" when the normal calculation process is bypassed and a specific amount of money is funded to a reserve component. For example, if the normal calculation process funds \$1,000 to the roofs each month, but the association would like to show \$500 funded to roofs each month, a "fixed" contribution of \$500 can be assigned.

### **Number of Units (or other assessment basis)**

Indicates the number of units for which the reserve analysis was prepared. In "phased" developments (see phasing), this number represents the number of units, and corresponding common area components, that existed as of a certain point in time.

For some associations, assessments and reserve contributions are based on a unit of measure other than the number of units. Examples include time-interval weeks for timeshare resorts or lot acreage for commercial/industrial developments.

## Preface

### **One-Time Replacement**

Used for components that will be budgeted for only once.

### **Percent Funded**

A measure, expressed as a percentage, of the association's reserve fund "health" as of a certain point in time. This number is the ratio of the anticipated reserve fund balance to the fully funded reserve balance:

$$\text{Percent Funded} = \frac{\text{Anticipated Reserve Fund Balance}}{\text{Fully Funded Reserve Balance}}$$

An association that is 100% funded does not have all of the reserve funds necessary to replace all of its reserve components immediately; it has the proportionately appropriate reserve funds for the reserve components it maintains, based on each component's current replacement cost, age and useful life.

### **Percentage of Replacement**

The percentage of the reserve component that is expected to be replaced.

For most reserve components, this percentage should be 100%. In some cases, this percentage may be more or less than 100%. For example, fencing which is shared with a neighboring community may be set at 50%.

### **Phasing**

Indicates the number of phases for which the reserve analysis was prepared and the total number of phases expected at build-out (i.e. Phase 4 of 7). In phased developments, the first number represents the number of phases, and corresponding common area components, that existed as of a certain point in time. The second number represents the number of phases that are expected to exist at build-out.

### **Placed-In-Service Date**

The date (month and year) that the reserve component was originally put into service or last replaced.

### **Remaining Life**

The length of time, in years, until a reserve component is scheduled to be replaced.

### **Remaining Life Adjustment**

The length of time, in years, that a reserve component is expected to last in excess (or deficiency) of its useful life for the current cycle of replacement.

If the current cycle of replacement for a reserve component is expected to be greater than or less than the "normal" life expectancy, the reserve component's life should be adjusted using a remaining life adjustment.

For example, if wood trim is painted normally on a 4 year cycle, the useful life should be 4 years. However, when it comes time to paint the wood trim and it is determined that it can be deferred for an additional year, the useful life should remain at 4 years and a remaining life adjustment of +1 year should be used.

### **Replacement Year**

The fiscal year that a reserve component is scheduled to be replaced.

### **Reserve Components**

Line items included in the reserve analysis.

### **Taxes on Investments Parameter**

The rate used to offset the investment rate parameter in the calculation of the interest contribution. This parameter represents the marginal tax rate the association expects to pay on interest earned by the reserve funds and member contributions.

# Preface

## Total Contribution

The sum of the membership contribution and interest contribution.

## Useful Life

The length of time, in years, that a reserve component is expected to last each time it is replaced. See also “remaining life adjustment.”

## ◆ ◆ ◆ ◆ LIMITATIONS OF RESERVE ANALYSIS ◆ ◆ ◆ ◆

This reserve analysis is intended as a tool for the association’s Board of Directors to be used in evaluating the association’s current physical and financial condition with regard to reserve components. The results of this reserve analysis represent the independent opinion of the preparer. There is no implied warranty or guarantee of this work product.

For the purposes of this reserve analysis, it has been assumed that all components have been installed properly, no construction defects exist and all components are operational. Additionally, it has been assumed that all components will be maintained properly in the future.

The representations set forth in this reserve analysis are based on the best information and estimates of the preparer as of the date of this analysis. These estimates are subject to change. This reserve analysis includes estimates of replacement costs and life expectancies as well as assumptions regarding future events. Some estimates are projections of future events based on information currently available and are not necessarily indicative of the actual future outcome. The longer the time period between the estimate and the estimated event, the more likely the possibility of error and/or discrepancy. For example, some assumptions inevitably will not materialize and unanticipated events and circumstances may occur subsequent to the preparation of this reserve analysis. Therefore, the actual replacement costs and remaining lives may vary from this reserve analysis and the variation may be significant. Additionally, inflation and other economic events may impact this reserve analysis, particularly over an extended period of time and those events could have a significant and negative impact on the accuracy of this reserve analysis and, further, the funds available to meet the association’s obligation for repair, replacement or other maintenance of major components during their estimated useful life. Furthermore, the occurrence of vandalism, severe weather conditions, earthquakes, floods, acts of nature or other unforeseen events cannot be predicted and/or accounted for and are excluded when assessing life expectancy, repair and/or replacement costs of the components.

# Sample Condominium Association

## Executive Summary

### Directed Cash Flow Calculation Method

#### Client Information:

Account Number	13103
Version Number	1
Analysis Date	03/06/2021
Fiscal Year	1/1/2022 to 12/31/2022
Number of Units	197
Phasing	17 of 17

#### Global Parameters:

Inflation Rate	2.50 %
Annual Contribution Increase	2.50 %
Investment Rate	1.50 %
Taxes on Investments	30.00 %
Contingency	3.00 %

#### Community Profile:

This community consists of 197 attached units with private roadways and landscaped areas.

For budgeting purposes, unless otherwise indicated, we have used June 2015 as the average placed-in-service date for aging the original components included in this analysis.

ARS site visits: March 29, 2021, July 3, 2019, September 2018 & September 2015

#### Adequacy of Reserves as of January 1, 2022:

Anticipated Reserve Balance	\$1,188,295.00
Fully Funded Reserve Balance	\$1,493,224.42
Percent Funded	79.58%

Recommended Funding for the 2022 Fiscal Year:	Annual	Monthly	Per Unit
			Per Month
Member Contribution	\$315,000	\$26,250.00	\$133.25
Interest Contribution	\$11,681	\$973.42	\$4.94
Total Contribution	\$326,681	\$27,223.42	\$138.19



# Sample Condominium Association

## Membership Disclosure Summary

Sorted by Category

Major Reserve Components	Current Cost	Assigned Reserves	Remaining Life Range	Useful Life Range
010 Streets	\$240,471	\$67,203	3-18	5-25
020 Roofing	\$1,764,918	\$11,047	23-34	30-41
030 Painting	\$501,892	\$389,467	0-4	4-11
040 Fencing & Walls	\$297,599	\$70,521	18-23	25-30
050 Lighting	\$178,800	\$55,823	13-23	20-30
060 Buildings	\$1,653,364	\$512,317	2-23	5-30
070 Landscape	\$33,000	\$26,525	0-5	2-12
080 Miscellaneous	\$77,600	\$20,781	18	25
Contingency	n.a.	\$34,611	n.a.	n.a.
Total	\$4,747,644	\$1,188,295	0-34	2-41

# Sample Condominium Association

## Calculation of Percent Funded

Sorted by Category

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
<b><u>010 Streets</u></b>				
Streets - Asphalt, Overlay / Major Rehab	18	25	\$219,248.00	\$58,713.87
Streets - Asphalt, Repair	3	5	\$10,149.98	\$4,059.99
Streets - Asphalt, Seal Coat	3	5	\$11,072.70	\$4,429.08
Streets - Concrete, Unfunded	n.a.	n.a.	\$0.00	\$0.00
<b>Sub Total</b>	<b>3-18</b>	<b>5-25</b>	<b>\$240,470.68</b>	<b>\$67,202.94</b>
<b><u>020 Roofing</u></b>				
Roofing - Rain Gutters	23	30	\$344,736.00	\$76,715.90
Roofing - Tile	34	41	\$1,420,182.00	\$230,378.60
<b>Sub Total</b>	<b>23-34</b>	<b>30-41</b>	<b>\$1,764,918.00</b>	<b>\$307,094.50</b>
<b><u>030 Painting</u></b>				
Painting - Aluminum Fencing	1	8	\$11,925.00	\$10,352.47
Painting - Miscellaneous Metal	3	4	\$8,000.00	\$975.61
Painting - Stucco	4	11	\$274,711.50	\$170,883.53
Painting - Woodwork & Trim	0	4	\$207,255.28	\$207,255.28
<b>Sub Total</b>	<b>0-4</b>	<b>4-11</b>	<b>\$501,891.78</b>	<b>\$389,466.90</b>
<b><u>040 Fencing &amp; Walls</u></b>				
Fencing - Aluminum	18	25	\$71,350.00	\$19,107.29
Railing - Wrought Iron	23	30	\$202,700.00	\$45,107.89
Walls - Stucco, Repair	18	25	\$23,548.75	\$6,306.28
<b>Sub Total</b>	<b>18-23</b>	<b>25-30</b>	<b>\$297,598.75</b>	<b>\$70,521.45</b>
<b><u>050 Lighting</u></b>				
Lighting - Buildings	13	20	\$125,350.00	\$42,138.94
Lighting - Streets / Parking	23	30	\$37,700.00	\$8,389.58
Lighting - Walkways	13	20	\$15,750.00	\$5,294.68
<b>Sub Total</b>	<b>13-23</b>	<b>20-30</b>	<b>\$178,800.00</b>	<b>\$55,823.19</b>
<b><u>060 Buildings</u></b>				
Buildings - Decks, Civil Code 5551	2	9	\$11,000.00	\$8,436.89
Buildings - Decks, Coated (Resurface)	8	15	\$108,528.00	\$48,992.64
Buildings - Decks, Coated (Top Coat)	4	5	\$31,796.42	\$4,542.35
Buildings - Decks, Wood	23	30	\$221,760.00	\$49,349.41
Buildings - Doors, Garage	18	25	\$246,250.00	\$65,944.92
Buildings - Doors, Unit Entry	18	25	\$318,750.00	\$85,360.17
Buildings - Doors, Utility Closets	18	25	\$187,800.00	\$50,292.20
Buildings - Fire Alarm Control Panels	13	20	\$133,250.00	\$44,794.68

# Sample Condominium Association

## Calculation of Percent Funded

Sorted by Category

	Remaining Life	Useful Life	Current Cost	Fully Funded Balance
Buildings - Metal Building Trim	23	30	\$55,500.00	\$12,350.70
Buildings - Termite Control	8	15	\$246,250.00	\$111,164.29
Buildings - Wood Shutters	13	20	\$92,480.00	\$31,089.02
<b>Sub Total</b>	<b>2-23</b>	<b>5-30</b>	<b>\$1,653,364.42</b>	<b>\$512,317.27</b>
<b><u>070 Landscape</u></b>				
Landscape - Irrigation Controller	5	12	\$15,000.00	\$8,525.18
Landscape - Renovation, Unfunded	n.a.	n.a.	\$0.00	\$0.00
Landscape - Tree Trimming	0	2	\$18,000.00	\$18,000.00
<b>Sub Total</b>	<b>0-5</b>	<b>2-12</b>	<b>\$33,000.00</b>	<b>\$26,525.18</b>
<b><u>080 Miscellaneous</u></b>				
Mailboxes	18	25	\$45,600.00	\$12,211.53
Metal Arches	18	25	\$32,000.00	\$8,569.49
<b>Sub Total</b>	<b>18</b>	<b>25</b>	<b>\$77,600.00</b>	<b>\$20,781.02</b>
Contingency	n.a.	n.a.	n.a.	\$43,491.97
<b>Total</b>	<b>0-34</b>	<b>2-41</b>	<b>\$4,747,643.63</b>	<b>\$1,493,224.42</b>
<b>Anticipated Reserve Balance</b>				<b>\$1,188,295.00</b>
<b>Percent Funded</b>				<b>79.58%</b>

**Sample Condominium Association**  
**Management / Accounting Summary**  
**Directed Cash Flow Calculation Method; Sorted by Category**


	Balance at Fiscal Year Beginning	Monthly Member Contribution	Monthly Interest Contribution	Total Monthly Contribution
<b><u>010 Streets</u></b>				
Streets - Asphalt, Overlay / Major Rehab	\$58,713.87	\$900.99	\$55.90	\$956.89
Streets - Asphalt, Repair	\$4,059.99	\$175.51	\$4.43	\$179.94
Streets - Asphalt, Seal Coat	\$4,429.08	\$191.47	\$4.82	\$196.30
Streets - Concrete, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
<b>Sub Total</b>	<b>\$67,202.94</b>	<b>\$1,267.98</b>	<b>\$65.15</b>	<b>\$1,333.12</b>
<b><u>020 Roofing</u></b>				
Roofing - Rain Gutters	\$11,046.52	\$1,413.43	\$16.65	\$1,430.08
Roofing - Tile	\$0.00	\$4,336.81	\$21.38	\$4,358.19
<b>Sub Total</b>	<b>\$11,046.52</b>	<b>\$5,750.24</b>	<b>\$38.03</b>	<b>\$5,788.27</b>
<b><u>030 Painting</u></b>				
Painting - Aluminum Fencing	\$10,352.47	\$142.53	\$9.78	\$152.31
Painting - Miscellaneous Metal	\$975.61	\$198.11	\$1.83	\$199.94
Painting - Stucco	\$170,883.53	\$2,398.79	\$161.59	\$2,560.37
Painting - Woodwork & Trim	\$207,255.28	\$4,389.49	\$21.64	\$4,411.13
<b>Sub Total</b>	<b>\$389,466.90</b>	<b>\$7,128.92</b>	<b>\$194.84</b>	<b>\$7,323.76</b>
<b><u>040 Fencing &amp; Walls</u></b>				
Fencing - Aluminum	\$19,107.29	\$293.21	\$18.19	\$311.40
Railing - Wrought Iron	\$45,107.89	\$714.17	\$43.05	\$757.22
Walls - Stucco, Repair	\$6,306.28	\$96.77	\$6.00	\$102.77
<b>Sub Total</b>	<b>\$70,521.45</b>	<b>\$1,104.15</b>	<b>\$67.24</b>	<b>\$1,171.39</b>
<b><u>050 Lighting</u></b>				
Lighting - Buildings	\$42,138.94	\$626.56	\$40.02	\$666.58
Lighting - Streets / Parking	\$8,389.58	\$132.83	\$8.00	\$140.83
Lighting - Walkways	\$5,294.68	\$78.73	\$5.02	\$83.75
<b>Sub Total</b>	<b>\$55,823.19</b>	<b>\$838.11</b>	<b>\$53.05</b>	<b>\$891.16</b>
<b><u>060 Buildings</u></b>				
Buildings - Decks, Civil Code 5551	\$8,436.89	\$116.91	\$7.97	\$124.89
Buildings - Decks, Coated (Resurface)	\$48,992.64	\$705.63	\$46.42	\$752.05
Buildings - Decks, Coated (Top Coat)	\$4,542.35	\$582.53	\$6.86	\$589.39
Buildings - Decks, Wood	\$49,349.41	\$781.32	\$47.10	\$828.42
Buildings - Doors, Garage	\$65,944.92	\$1,011.95	\$62.79	\$1,074.74
Buildings - Doors, Unit Entry	\$85,360.17	\$1,309.89	\$81.27	\$1,391.15

**Sample Condominium Association**  
**Management / Accounting Summary**  
**Directed Cash Flow Calculation Method; Sorted by Category**

	<b>Balance at Fiscal Year Beginning</b>	<b>Monthly Member Contribution</b>	<b>Monthly Interest Contribution</b>	<b>Total Monthly Contribution</b>
Buildings - Doors, Utility Closets	\$50,292.20	\$771.76	\$47.88	\$819.64
Buildings - Fire Alarm Control Panels	\$44,794.68	\$666.05	\$42.54	\$708.59
Buildings - Metal Building Trim	\$12,350.70	\$195.54	\$11.79	\$207.33
Buildings - Termite Control	\$111,164.29	\$1,601.08	\$105.32	\$1,706.40
Buildings - Wood Shutters	\$31,089.02	\$462.26	\$29.52	\$491.78
<b>Sub Total</b>	<b>\$512,317.27</b>	<b>\$8,204.93</b>	<b>\$489.46</b>	<b>\$8,694.39</b>
<b><u>070 Landscape</u></b>				
Landscape - Irrigation Controller	\$8,525.18	\$120.45	\$8.06	\$128.51
Landscape - Renovation, Unfunded	\$0.00	\$0.00	\$0.00	\$0.00
Landscape - Tree Trimming	\$18,000.00	\$751.78	\$3.71	\$755.48
<b>Sub Total</b>	<b>\$26,525.18</b>	<b>\$872.22</b>	<b>\$11.77</b>	<b>\$883.99</b>
<b><u>080 Miscellaneous</u></b>				
Mailboxes	\$12,211.53	\$187.39	\$11.62	\$199.01
Metal Arches	\$8,569.49	\$131.50	\$8.15	\$139.66
<b>Sub Total</b>	<b>\$20,781.02</b>	<b>\$318.89</b>	<b>\$19.78</b>	<b>\$338.67</b>
Contingency	\$34,610.53	\$764.56	\$34.10	\$798.66
<b>Total</b>	<b>\$1,188,295.00</b>	<b>\$26,250.00</b>	<b>\$973.42</b>	<b>\$27,223.42</b>


**Sample Condominium Association**  
**Management / Accounting Charts**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Distribution of Current Reserve Fund**

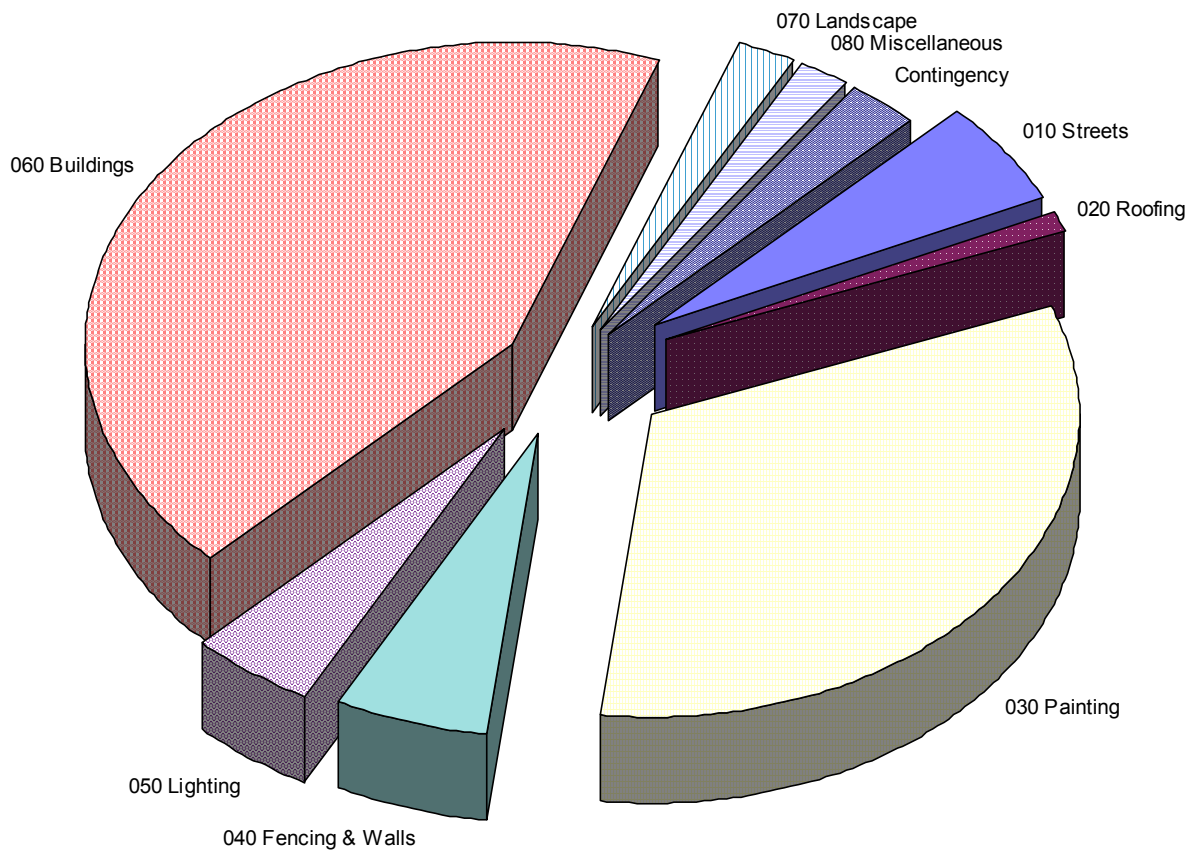

**Sample Condominium Association**  
**Management / Accounting Charts**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Monthly Member Contribution**

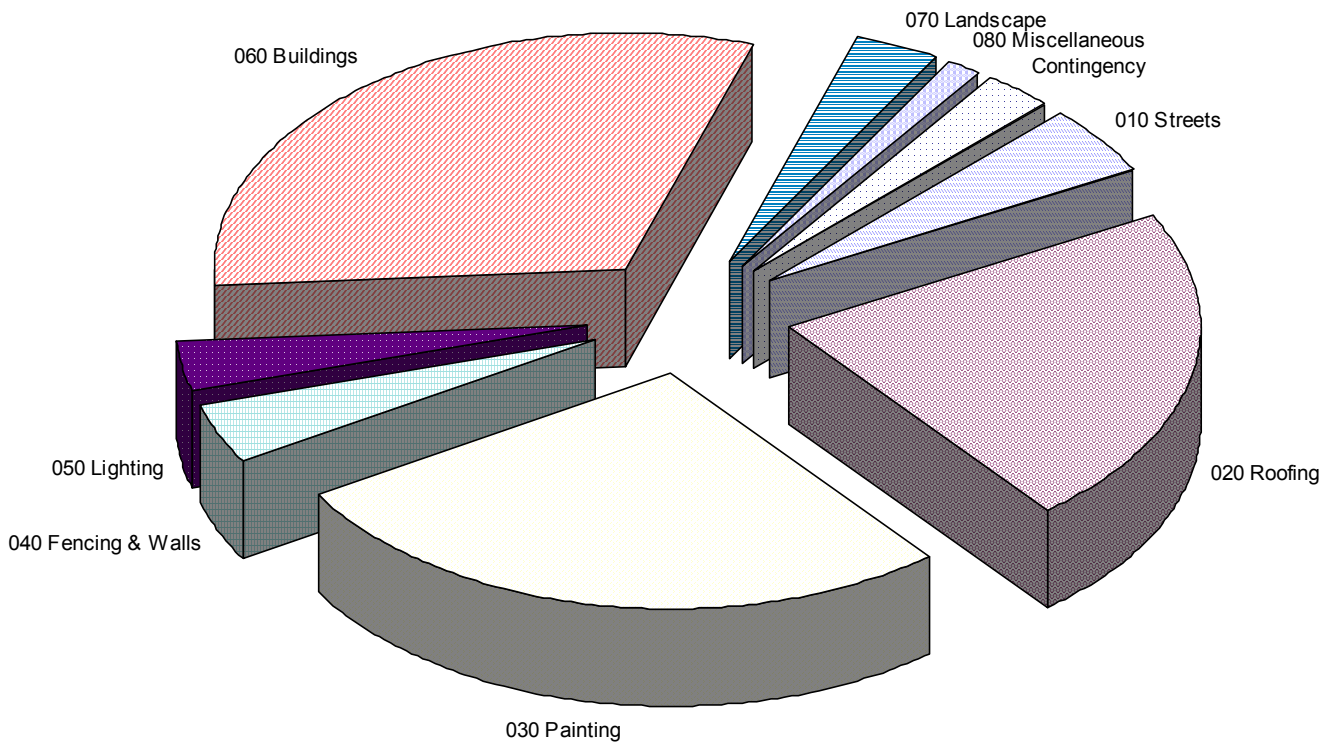

# Sample Condominium Association

## Annual Expenditure Detail

### Sorted by Description

<b>2022 Fiscal Year</b>		
Landscape - Tree Trimming		\$18,000.00
Painting - Woodwork & Trim		\$207,255.28
<b>Sub Total</b>		<b>\$225,255.28</b>
<b>2023 Fiscal Year</b>		
Painting - Aluminum Fencing		\$12,223.13
<b>Sub Total</b>		<b>\$12,223.13</b>
<b>2024 Fiscal Year</b>		
Buildings - Decks, Civil Code 5551		\$11,556.88
Landscape - Tree Trimming		\$18,911.25
<b>Sub Total</b>		<b>\$30,468.13</b>
<b>2025 Fiscal Year</b>		
Painting - Miscellaneous Metal		\$8,615.13
Streets - Asphalt, Repair		\$10,930.41
Streets - Asphalt, Seal Coat		\$11,924.09
<b>Sub Total</b>		<b>\$31,469.62</b>
<b>2026 Fiscal Year</b>		
Buildings - Decks, Coated (Top Coat)		\$35,097.30
Landscape - Tree Trimming		\$19,868.63
Painting - Aluminum Fencing		\$13,162.97
Painting - Stucco		\$303,230.09
Painting - Woodwork & Trim		\$228,771.05
<b>Sub Total</b>		<b>\$600,130.05</b>
<b>2027 Fiscal Year</b>		
Landscape - Irrigation Controller		\$16,971.12
<b>Sub Total</b>		<b>\$16,971.12</b>
<b>2028 Fiscal Year</b>		
Landscape - Tree Trimming		\$20,874.48
<b>Sub Total</b>		<b>\$20,874.48</b>
<b>2029 Fiscal Year</b>		
Painting - Aluminum Fencing		\$14,175.08
Painting - Miscellaneous Metal		\$9,509.49
<b>Sub Total</b>		<b>\$23,684.56</b>



**Sample Condominium Association**  
**Annual Expenditure Detail**  
**Sorted by Description**

**2030 Fiscal Year**

Buildings - Decks, Coated (Resurface)	\$132,230.83
Buildings - Termite Control	\$300,031.71
Landscape - Tree Trimming	\$21,931.25
Painting - Woodwork & Trim	\$252,520.44
Streets - Asphalt, Repair	\$12,366.76
Streets - Asphalt, Seal Coat	\$13,491.01

**Sub Total** **\$732,572.00**

**2031 Fiscal Year**

Buildings - Decks, Coated (Top Coat)	\$39,709.37
--------------------------------------	-------------

**Sub Total** **\$39,709.37**

**2032 Fiscal Year**

Landscape - Tree Trimming	\$23,041.52
Painting - Aluminum Fencing	\$15,265.01

**Sub Total** **\$38,306.53**

**2033 Fiscal Year**

Buildings - Decks, Civil Code 5551	\$14,432.95
Painting - Miscellaneous Metal	\$10,496.69

**Sub Total** **\$24,929.65**

**2034 Fiscal Year**

Landscape - Tree Trimming	\$24,208.00
Painting - Stucco	\$369,456.43
Painting - Woodwork & Trim	\$278,735.31

**Sub Total** **\$672,399.74**

**2035 Fiscal Year**

Buildings - Fire Alarm Control Panels	\$183,686.60
Buildings - Wood Shutters	\$127,484.70
Lighting - Buildings	\$172,796.36
Lighting - Walkways	\$21,711.55
Painting - Aluminum Fencing	\$16,438.74
Streets - Asphalt, Repair	\$13,991.85
Streets - Asphalt, Seal Coat	\$15,263.84

**Sub Total** **\$551,373.64**

**2036 Fiscal Year**

Buildings - Decks, Coated (Top Coat)	\$44,927.51
--------------------------------------	-------------

**Sample Condominium Association**  
**Annual Expenditure Detail**  
**Sorted by Description**

Landscape - Tree Trimming	\$25,433.53
<b>Sub Total</b>	<b>\$70,361.04</b>
<b>2037 Fiscal Year</b>	
Painting - Miscellaneous Metal	\$11,586.39
<b>Sub Total</b>	<b>\$11,586.39</b>
<b>2038 Fiscal Year</b>	
Landscape - Tree Trimming	\$26,721.10
Painting - Aluminum Fencing	\$17,702.73
Painting - Woodwork & Trim	\$307,671.63
<b>Sub Total</b>	<b>\$352,095.46</b>
<b>2039 Fiscal Year</b>	
Landscape - Irrigation Controller	\$22,824.27
<b>Sub Total</b>	<b>\$22,824.27</b>
<b>2040 Fiscal Year</b>	
Buildings - Doors, Garage	\$384,065.96
Buildings - Doors, Unit Entry	\$497,141.22
Buildings - Doors, Utility Closets	\$292,903.91
Fencing - Aluminum	\$111,281.65
Landscape - Tree Trimming	\$28,073.86
Mailboxes	\$71,120.44
Metal Arches	\$49,909.08
Streets - Asphalt, Overlay / Major Rehab	\$341,952.05
Streets - Asphalt, Repair	\$15,830.50
Streets - Asphalt, Seal Coat	\$17,269.63
Walls - Stucco, Repair	\$36,728.01
<b>Sub Total</b>	<b>\$1,846,276.30</b>
<b>2041 Fiscal Year</b>	
Buildings - Decks, Coated (Top Coat)	\$50,831.35
Painting - Aluminum Fencing	\$19,063.90
Painting - Miscellaneous Metal	\$12,789.20
<b>Sub Total</b>	<b>\$82,684.46</b>
<b>2042 Fiscal Year</b>	
Buildings - Decks, Civil Code 5551	\$18,024.78
Landscape - Tree Trimming	\$29,495.10
Painting - Stucco	\$450,146.78

**Sample Condominium Association**  
**Annual Expenditure Detail**  
**Sorted by Description**

Painting - Woodwork & Trim	\$339,611.91
<b>Sub Total</b>	<b>\$837,278.57</b>
 <b>2044 Fiscal Year</b>	
Landscape - Tree Trimming	\$30,988.29
Painting - Aluminum Fencing	\$20,529.74
<b>Sub Total</b>	<b>\$51,518.02</b>
 <b>2045 Fiscal Year</b>	
Buildings - Decks, Coated (Resurface)	\$191,509.67
Buildings - Decks, Wood	\$391,320.07
Buildings - Metal Building Trim	\$97,935.89
Buildings - Termite Control	\$434,535.38
Lighting - Streets / Parking	\$66,525.82
Painting - Miscellaneous Metal	\$14,116.89
Railing - Wrought Iron	\$357,686.59
Roofing - Rain Gutters	\$608,324.83
Streets - Asphalt, Repair	\$17,910.75
Streets - Asphalt, Seal Coat	\$19,539.00
<b>Sub Total</b>	<b>\$2,199,404.89</b>
 <b>2046 Fiscal Year</b>	
Buildings - Decks, Coated (Top Coat)	\$57,511.01
Landscape - Tree Trimming	\$32,557.07
Painting - Woodwork & Trim	\$374,868.01
<b>Sub Total</b>	<b>\$464,936.08</b>
 <b>2047 Fiscal Year</b>	
Painting - Aluminum Fencing	\$22,108.28
<b>Sub Total</b>	<b>\$22,108.28</b>
 <b>2048 Fiscal Year</b>	
Landscape - Tree Trimming	\$34,205.27
<b>Sub Total</b>	<b>\$34,205.27</b>
 <b>2049 Fiscal Year</b>	
Painting - Miscellaneous Metal	\$15,582.40
<b>Sub Total</b>	<b>\$15,582.40</b>
 <b>2050 Fiscal Year</b>	
Landscape - Tree Trimming	\$35,936.91

# Sample Condominium Association

## Annual Expenditure Detail

Sorted by Description

Painting - Aluminum Fencing	\$23,808.20
Painting - Stucco	\$548,460.14
Painting - Woodwork & Trim	\$413,784.14
Streets - Asphalt, Repair	\$20,264.37
Streets - Asphalt, Seal Coat	\$22,106.59
<b>Sub Total</b>	<b>\$1,064,360.36</b>
<b>2051 Fiscal Year</b>	
Buildings - Decks, Civil Code 5551	\$22,510.48
Buildings - Decks, Coated (Top Coat)	\$65,068.43
Landscape - Irrigation Controller	\$30,696.11
<b>Sub Total</b>	<b>\$118,275.02</b>

# Sample Condominium Association

## Projections

### Directed Cash Flow Calculation Method



Fiscal Year	Beginning Balance	Member Contribution	Interest Contribution	Expenditures	Ending Balance	Fully Funded Ending Balance	Percent Funded
2022	\$1,188,295	\$315,000	\$11,681	\$225,255	\$1,289,721	\$1,565,212	82%
2023	\$1,289,721	\$322,875	\$15,037	\$12,223	\$1,615,410	\$1,873,320	86%
2024	\$1,615,410	\$330,947	\$18,320	\$30,468	\$1,934,208	\$2,176,849	89%
2025	\$1,934,208	\$339,221	\$21,712	\$31,470	\$2,263,671	\$2,493,743	91%
2026	\$2,263,671	\$347,701	\$19,230	\$600,130	\$2,030,472	\$2,234,826	91%
2027	\$2,030,472	\$356,394	\$22,964	\$16,971	\$2,392,858	\$2,592,862	92%
2028	\$2,392,858	\$365,303	\$26,789	\$20,874	\$2,764,076	\$2,963,729	93%
2029	\$2,764,076	\$374,436	\$30,720	\$23,685	\$3,145,548	\$3,349,103	94%
2030	\$3,145,548	\$383,797	\$27,311	\$732,572	\$2,824,084	\$3,003,242	94%
2031	\$2,824,084	\$393,392	\$31,276	\$39,709	\$3,209,042	\$3,388,819	95%
2032	\$3,209,042	\$403,227	\$35,400	\$38,307	\$3,609,362	\$3,794,328	95%
2033	\$3,609,362	\$413,307	\$39,813	\$24,930	\$4,037,553	\$4,233,127	95%
2034	\$4,037,553	\$423,640	\$37,549	\$672,400	\$3,826,342	\$4,008,587	95%
2035	\$3,826,342	\$434,231	\$36,649	\$551,374	\$3,745,849	\$3,915,126	96%
2036	\$3,745,849	\$445,087	\$40,927	\$70,361	\$4,161,501	\$4,336,869	96%
2037	\$4,161,501	\$456,214	\$45,986	\$11,586	\$4,652,115	\$4,841,160	96%
2038	\$4,652,115	\$467,619	\$47,625	\$352,095	\$4,815,264	\$5,008,769	96%
2039	\$4,815,264	\$479,310	\$52,877	\$22,824	\$5,324,627	\$5,538,654	96%
2040	\$5,324,627	\$491,292	\$39,070	\$1,846,276	\$4,008,713	\$4,166,719	96%
2041	\$4,008,713	\$503,575	\$43,853	\$82,684	\$4,473,456	\$4,633,368	97%
2042	\$4,473,456	\$516,164	\$40,855	\$837,279	\$4,193,197	\$4,326,265	97%
2043	\$4,193,197	\$529,068	\$46,795	\$0	\$4,769,060	\$4,906,967	97%
2044	\$4,769,060	\$542,295	\$52,391	\$51,518	\$5,312,228	\$5,459,610	97%
2045	\$5,312,228	\$555,852	\$35,525	\$2,199,405	\$3,704,201	\$3,769,792	98%
2046	\$3,704,201	\$569,749	\$36,926	\$464,936	\$3,845,940	\$3,881,286	99%
2047	\$3,845,940	\$583,992	\$43,163	\$22,108	\$4,450,986	\$4,475,787	99%
2048	\$4,450,986	\$598,592	\$49,489	\$34,205	\$5,064,862	\$5,085,398	100%
2049	\$5,064,862	\$613,557	\$56,235	\$15,582	\$5,719,072	\$5,743,257	100%
2050	\$5,719,072	\$628,896	\$52,146	\$1,064,360	\$5,335,753	\$5,323,994	100%
2051	\$5,335,753	\$644,618	\$58,159	\$118,275	\$5,920,256	\$5,907,101	100%

NOTE: In some cases, the projected Ending Balance may exceed the Fully Funded Ending Balance in years following high Expenditures. This is a result of the provision for contingency in this analysis, which in these projections is never expended. The contingency is continually adjusted according to need and any excess is redistributed among all components included.

# Sample Condominium Association

## Projection Charts



### Directed Cash Flow Calculation Method

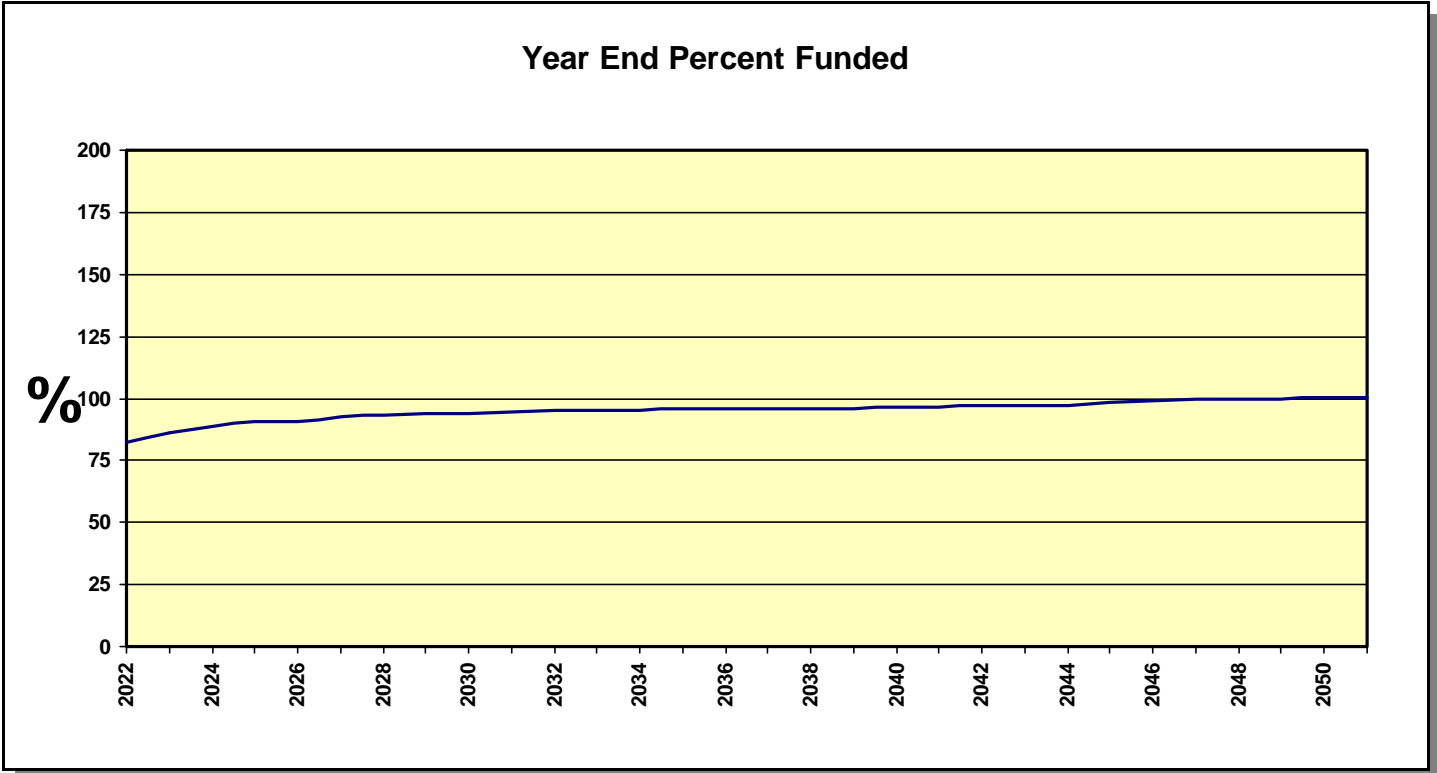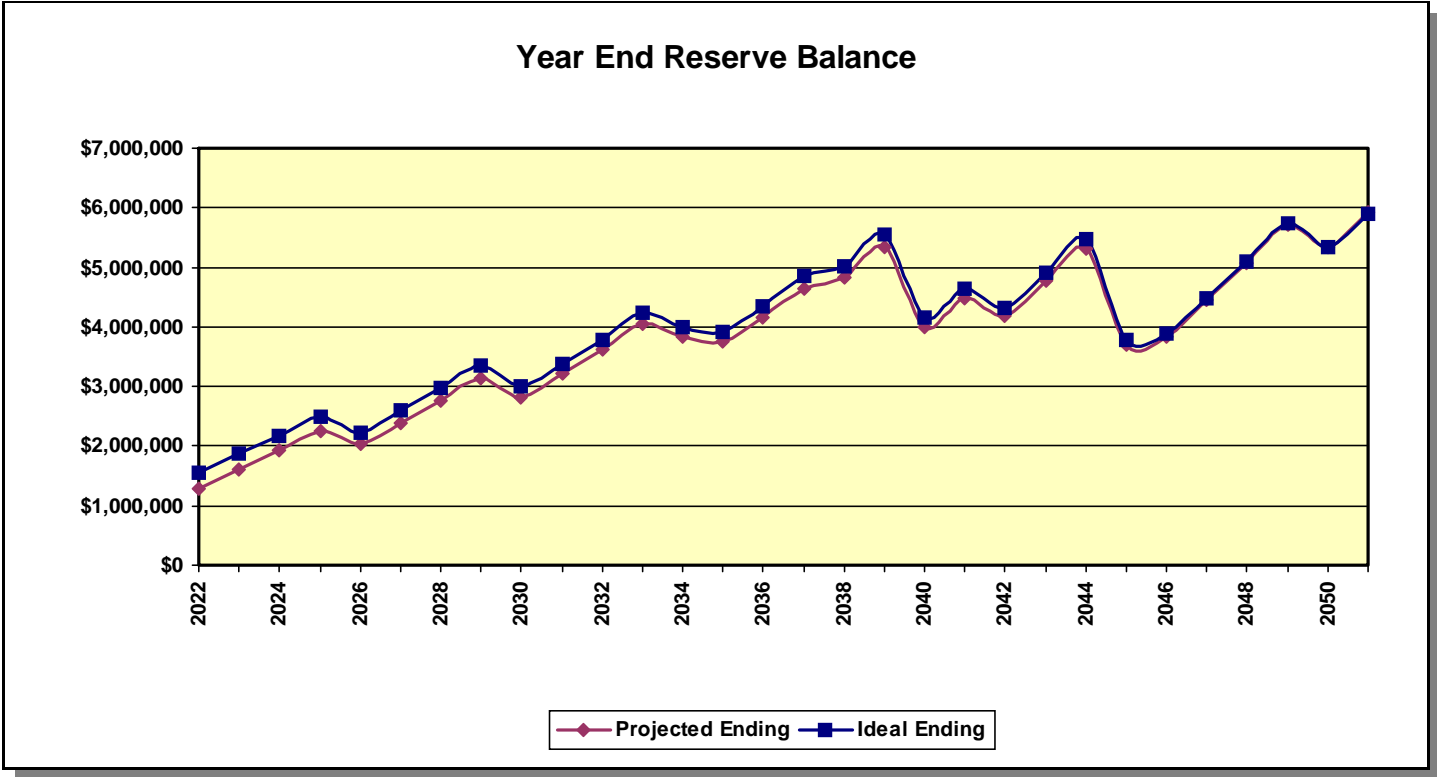

# Sample Condominium Association

## Projection Charts

### Directed Cash Flow Calculation Method

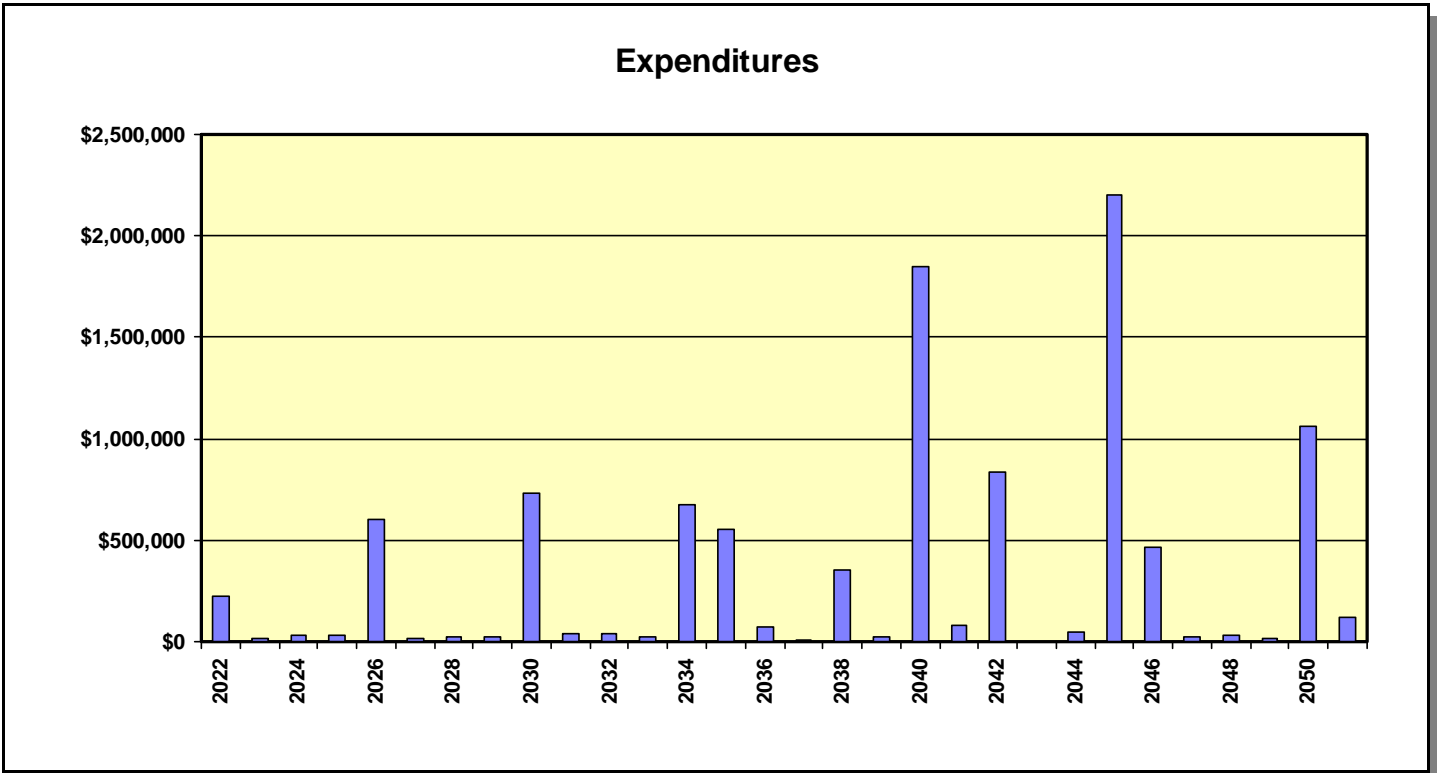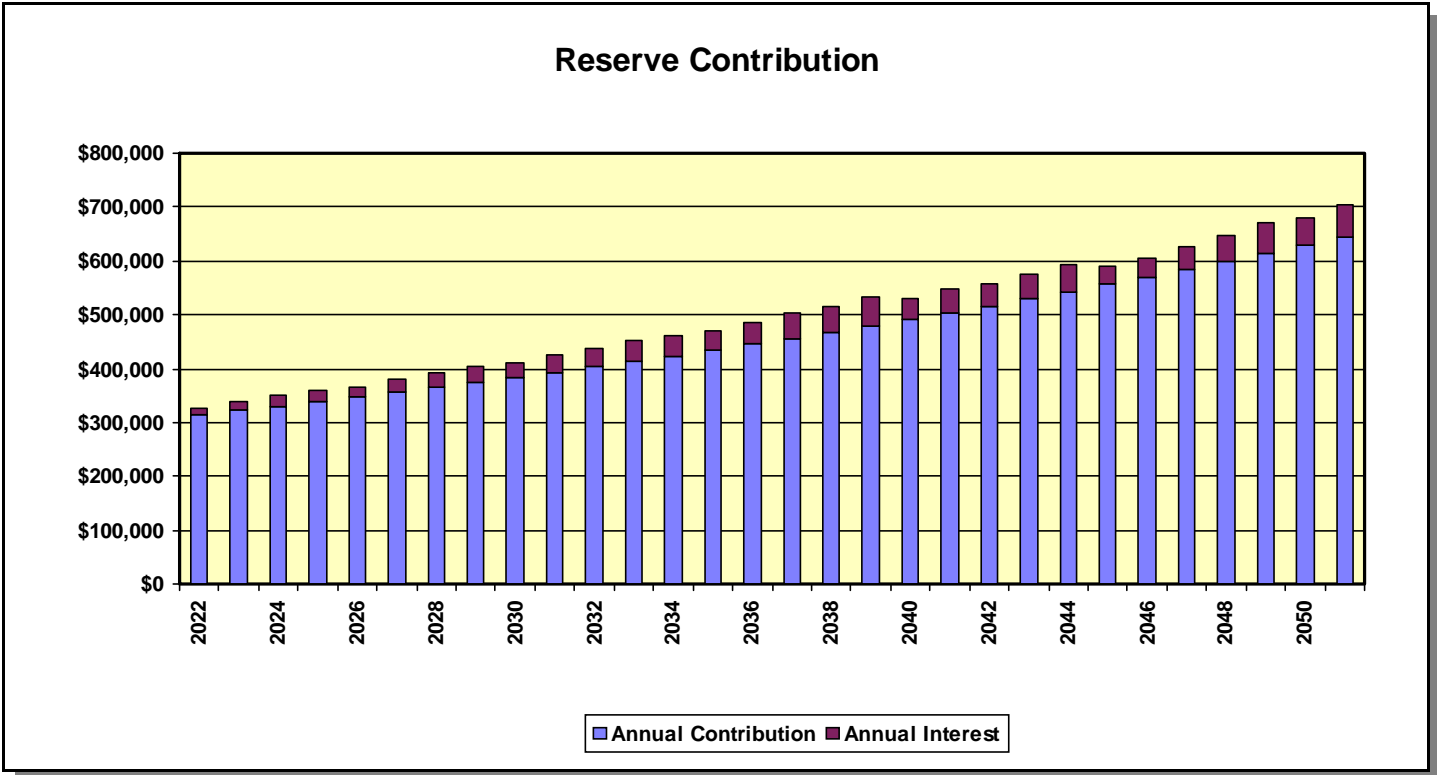

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Streets - Asphalt, Overlay / Major Rehab

Category	010 Streets	Quantity	1 total
Photos	March 2021	Unit Cost	\$219,248.00
		% of Replacement	100.00%
		Current Cost	\$219,248.00
		Future Cost	\$341,952.05
Placed In Service	06/15	Assigned Reserves at FYB	\$58,713.87
Useful Life	24	Monthly Member Contribution	\$900.99
Adjustment	+1	Monthly Interest Contribution	\$55.90
Remaining Life	18	Total Monthly Contribution	\$956.89
Replacement Year	2040		

Comments:



**EAST SIDE OF COMMUNITY:**

73,635	sq. ft. of overlay/major rehab	@	\$1.60	=	\$117,816.00
30	valve cover adjustments	@	\$250.00	=	\$7,500.00
10	manhole cover adjustments	@	\$400.00	=	\$4,000.00

**WEST SIDE OF COMMUNITY:**

49,395	sq. ft. of overlay/major rehab	@	\$1.60	=	\$79,032.00
22	valve cover adjustments	@	\$250.00	=	\$5,500.00
12	manhole cover adjustments	@	\$450.00	=	\$5,400.00

TOTAL = \$219,248.00

The association maintains Emerald Clover, Fairymoss, Jade Flower as well as the motorcourts and parking areas throughout the community.

Most asphalt areas can be expected to last approximately 20 to 25 years before it will become necessary for an overlay to be applied or other major rehabilitation to be completed. It will be necessary to adjust manhole and valve covers at the time the overlay is applied or other major rehabilitation is completed.



# **Sample Condominium Association**

## **Component Detail**

### **Directed Cash Flow Calculation Method; Sorted by Category**

Deflection testing should be conducted by an independent consultant near the end of the estimated useful life to determine the condition of the asphalt and estimated remaining life before the overlay or other major rehabilitation is required. In addition to this service, a consultant may be obtained to prepare the application specifications, and to work with the contractor during actual installation. It is recommended that the client obtain bids for such a consultation near the end of the estimated useful life. As costs vary, a provision for this consulting has not been included in this cost estimate. Should the client request, this cost can be incorporated into this analysis.

The remaining life of the asphalt overlay has been adjusted to align with the future replacement cycles of the asphalt repairs and seal coating.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Streets - Asphalt, Repair

Category	010 Streets	Quantity	123,030 sq. ft.
Photos	March 2021	Unit Cost	\$5.500
		% of Replacement	1.50%
		Current Cost	\$10,149.98
Placed In Service	01/20	Future Cost	\$10,930.41
Useful Life	5		
		Assigned Reserves at FYB	\$4,059.99
Remaining Life	3	Monthly Member Contribution	\$175.51
Replacement Year	2025	Monthly Interest Contribution	\$4.43
		Total Monthly Contribution	\$179.94

Comments:



east side of community	73,635 sq. ft.
west side of community	49,395
	123,030 sq. ft.

We have budgeted for the asphalt to be repaired on the same cycle and in conjunction with the seal coating of the asphalt, beginning with the second scheduled seal coating (significant repairs not anticipated with next scheduled seal coating).

It is estimated that a percentage of the asphalt areas will require repair or replacement. The actual condition of the asphalt should be monitored through time and these estimates adjusted accordingly.

The association repaired and seal coated the asphalt in September 2019 for a total cost of \$13,475.

For budgeting purposes, we have used the next fiscal year's beginning date as the placed-in-service date for this component.

The useful life estimate for this component has been provided by the client.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Streets - Asphalt, Seal Coat

Category	010 Streets	Quantity	123,030 sq. ft.
Photos	March 2021	Unit Cost	\$0.090
		% of Replacement	100.00%
		Current Cost	\$11,072.70
Placed In Service	01/20	Future Cost	\$11,924.09
Useful Life	5		
		Assigned Reserves at FYB	\$4,429.08
Remaining Life	3	Monthly Member Contribution	\$191.47
Replacement Year	2025	Monthly Interest Contribution	\$4.82
		Total Monthly Contribution	\$196.30

Comments:



east side of community	73,635 sq. ft.
west side of community	49,395
	123,030 sq. ft.

Asphalt surfaces should be seal coated on a 3 to 4 year cycle.

The association repaired and seal coated the asphalt in September 2019 for a total cost of \$13,475.

For budgeting purposes, we have used the next fiscal year's beginning date as the placed-in-service date for this component.

The useful life estimate for this component has been provided by the client.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Streets - Concrete, Unfunded

Category	010 Streets	Quantity	1 comment
Photos	March 2021	Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	06/15	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

Comments:



There are typical concrete sidewalks, curbs, gutters and draiage swales located throughout the community.

Typically, budgeting for concrete repairs as a reserve component is excluded as it is anticipated that any repairs required will be addressed immediately due to safety concerns. Good maintenance practice would not allow the need for repairs to accumulate to a point that they would become a major expense. Minor repairs, as needed, should be addressed immediately as a maintenance issue using the client's operating and/or reserve contingency funds. Should the client desire, funding for this component can be included.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Roofing - Rain Gutters

Category	020 Roofing	Quantity	43,092 lin. ft.
Photos	March 2021	Unit Cost	\$8.000
		% of Replacement	100.00%
		Current Cost	\$344,736.00
Placed In Service	06/15	Future Cost	\$608,324.83
Useful Life	30		
		Assigned Reserves at FYB	\$11,046.52
Remaining Life	23	Monthly Member Contribution	\$1,413.43
Replacement Year	2045	Monthly Interest Contribution	\$16.65
		Total Monthly Contribution	\$1,430.08

Comments:



These are the typical metal rain gutters and downspouts located throughout the community.

The association repaired/replaced rain gutters in January 2021 for a total cost of \$7,533.

The inventory for this component has been provided by the client in the form of the Department of Real Estate (DRE) reserve worksheets as originally prepared at the direction of the developer.

# Sample Condominium Association

## Component Detail

**Directed Cash Flow Calculation Method; Sorted by Category**

### Roofing - Tile

Category	020 Roofing	Quantity	236,697 sq. ft.
Photos	March 2021	Unit Cost	\$6.000
		% of Replacement	100.00%
		Current Cost	\$1,420,182.00
Placed In Service	06/15	Future Cost	\$3,288,178.82
Useful Life	40		
Adjustment	+1	Assigned Reserves at FYB	\$0.00
Remaining Life	34	Monthly Member Contribution	\$4,336.81
Replacement Year	2056	Monthly Interest Contribution	\$21.38
		Total Monthly Contribution	\$4,358.19

Comments:



The association intends to perform their 1st roof maintenance since inception in June 2021 for a total cost of \$10,895.

Tile roofs are designed to last the life of a community. However, the underlayment (waterproof membrane underneath the roof tiles) can be subject to deterioration and failure through time. The timing and rate of failure is difficult to predict and can vary significantly from one project to another depending largely on the quality of the original design and construction (materials and installation), exposure to outside influences (climate, foot traffic, etc.) and the level of routine maintenance.

For the purposes of this analysis, we have excluded budgeting for the complete replacement of the tile roofs and/or underlayment. It is anticipated that tile roof-related expenses can be effectively managed by the repair component included herein (see previous component) and as an annual operating/maintenance expense through time. It is recommended that the client include a line item in the annual operating budget for regularly scheduled inspections and repairs that may be necessary from time to time. The annual operating budget should be adjusted each year to reflect changes in tile roof-related requirements (based on inspections and scope of repairs needed).

The inventory for this component has been provided by the client in the form of the Department of Real Estate (DRE) reserve worksheets as originally prepared at the direction of the developer.

The remaining life of the tile roofs has been adjusted to align with the future replacement cycles of the tile maintenance.

**Sample Condominium Association**  
**Component Detail**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Painting - Aluminum Fencing**

Category	030 Painting	Quantity	5,300 sq. ft.
Photos	March 2021	Unit Cost	\$2.250
		% of Replacement	100.00%
		Current Cost	\$11,925.00
Placed In Service	06/15	Future Cost	\$12,223.13
Useful Life	3		
Adjustment	+5	Assigned Reserves at FYB	\$10,352.47
Remaining Life	1	Monthly Member Contribution	\$142.53
Replacement Year	2023	Monthly Interest Contribution	\$9.78
		Total Monthly Contribution	\$152.31

Comments:



This is the aluminum fencing located along the southern perimeter of the east side of the community (from Tulip to Sand Canyon +/-).

It is anticipated that this fencing will not require its first painting for an extended period of time. Thereafter, painting will be required more frequently; we have budgeted accordingly.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Painting - Miscellaneous Metal

Category	030 Painting	Quantity	1 provision
Photos	March 2021	Unit Cost	\$8,000.00
		% of Replacement	100.00%
		Current Cost	\$8,000.00
Placed In Service	08/21	Future Cost	\$8,615.13
Useful Life	4		
		Assigned Reserves at FYB	\$975.61
Remaining Life	3	Monthly Member Contribution	\$198.11
Replacement Year	2025	Monthly Interest Contribution	\$1.83
		Total Monthly Contribution	\$199.94

Comments:



- 13 street lights
- 14 mailbox clusters
- 7 bollard lights
- 8 "decorative" metal arches

The association intends to painted the miscellaneous metals throughou the community in August 2021 for a total cost of approximately \$8,000.



# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Painting - Stucco

Category	030 Painting	Quantity	366,282 sq. ft.
Photos	March 2021	Unit Cost	\$0.750
		% of Replacement	100.00%
		Current Cost	\$274,711.50
Placed In Service	06/15	Future Cost	\$303,230.09
Useful Life	8		
Adjustment	+3	Assigned Reserves at FYB	\$170,883.53
Remaining Life	4	Monthly Member Contribution	\$2,398.79
Replacement Year	2026	Monthly Interest Contribution	\$161.59
		Total Monthly Contribution	\$2,560.37

Comments:



Color coated stucco can last from 10 to 15 years before it will require its first painting, as the coloring is mixed into the stucco material. Thereafter, budgeting for the painting of the stucco has been scheduled to be completed every other time the woodwork is painted.

The inventory for this component has been provided by the client in the form of the Department of Real Estate (DRE) reserve worksheets as originally prepared at the direction of the developer.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Painting - Woodwork & Trim

Category	030 Painting	Quantity	64,638 sq. ft.
Photos	March 2021	Unit Cost	\$3.206
		% of Replacement	100.00%
		Current Cost	\$207,255.28
Placed In Service	01/18	Future Cost	\$228,771.05
Useful Life	4		
		Assigned Reserves at FYB	\$207,255.28
Remaining Life	0	Monthly Member Contribution	\$4,389.49
Replacement Year	2022	Monthly Interest Contribution	\$21.64
		Total Monthly Contribution	\$4,411.13

Comments:



This inventory includes the wrought iron stair and deck railings.

The association painted the woodwork and trim at Phases 1-16 in November of 2017 through April 2018 for a total cost of \$163,865. The association painted the utility closets in November 2019 for a total cost of \$7,500.

The current cost used for this component is based on actual expenditures incurred at last replacement, and has been adjusted for inflation where applicable.

For budgeting purposes, we have used the next fiscal year's beginning date as the placed-in-service date for this component.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Fencing - Aluminum

Category	040 Fencing & Walls	Quantity	1 total
Photos	March 2021	Unit Cost	\$71,350.00
		% of Replacement	100.00%
		Current Cost	\$71,350.00
Placed In Service	06/15	Future Cost	\$111,281.65
Useful Life	25		
		Assigned Reserves at FYB	\$19,107.29
Remaining Life	18	Monthly Member Contribution	\$293.21
Replacement Year	2040	Monthly Interest Contribution	\$18.19
		Total Monthly Contribution	\$311.40

Comments:



This is the aluminum fencing located along the southern perimeter of the east side of the community (from Tulip to Sand Canyon +/-):

880 - lin. ft. of 6' fencing*	@	\$80.00	=	\$70,400.00
1 - 3.5' x 6' gate	@	\$950.00	=	\$950.00
		TOTAL	=	\$71,350.00

The inventory for this component has been provided by the client in the form of the Department of Real Estate (DRE) reserve worksheets as originally prepared at the direction of the developer.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Railing - Wrought Iron

Category	040 Fencing & Walls	Quantity	1 total
Photos	March 2021	Unit Cost	\$202,700.00
		% of Replacement	100.00%
		Current Cost	\$202,700.00
Placed In Service	06/15	Future Cost	\$357,686.59
Useful Life	30		
		Assigned Reserves at FYB	\$45,107.89
Remaining Life	23	Monthly Member Contribution	\$714.17
Replacement Year	2045	Monthly Interest Contribution	\$43.05
		Total Monthly Contribution	\$757.22

Comments:



EAST SIDE OF COMMUNITY:

55 - lin. ft. of 3' to 3.5' stair railing*	@	\$52.50	=	\$2,887.50
1,470 - lin. ft. of 3.5' deck railing**	@	\$85.00	=	\$124,950.00

WEST SIDE OF COMMUNITY:

155 - lin. ft. of 3' to 3.5' stair railing*	@	\$52.50	=	\$8,137.50
785 - lin. ft. of 3.5' deck railing**	@	\$85.00	=	\$66,725.00
TOTAL				\$202,700.00

\* These railings are located at ground-level stairs.

\*\* These railings are located at decks and balconies.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Walls - Stucco, Repair

Category	040 Fencing & Walls	Quantity	18,839 sq. ft.
Photos	March 2021	Unit Cost	\$12.500
		% of Replacement	10.00%
		Current Cost	\$23,548.75
Placed In Service	06/15	Future Cost	\$36,728.01
Useful Life	25		
		Assigned Reserves at FYB	\$6,306.28
Remaining Life	18	Monthly Member Contribution	\$96.77
Replacement Year	2040	Monthly Interest Contribution	\$6.00
		Total Monthly Contribution	\$102.77

Comments:



EAST SIDE OF COMMUNITY:

attached patio walls	3,528 sq. ft.
front garden walls*	1,335

WEST SIDE OF COMMUNITY:

attached patio walls	11,016 sq. ft.
front garden walls*	2,960
	18,839 sq. ft.

\* These front "garden" walls are located in front of units along Tulip, Evening Sun, Velvet Flower, Rush Lily, Rose Arch and Scented Violet.

It is estimated that a percentage of the stucco walls will require repair or replacement through time. The actual condition of these walls should be monitored and the percentage of replacement and remaining life estimates adjusted accordingly.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Lighting - Buildings

Category	050 Lighting	Quantity	1 total
Photos	March 2021	Unit Cost	\$125,350.00
		% of Replacement	100.00%
		Current Cost	\$125,350.00
Placed In Service	06/15	Future Cost	\$172,796.36
Useful Life	20		
		Assigned Reserves at FYB	\$42,138.94
Remaining Life	13	Monthly Member Contribution	\$626.56
Replacement Year	2035	Monthly Interest Contribution	\$40.02
		Total Monthly Contribution	\$666.58

Comments:



This inventory includes the "common area" building lighting located throughout the community:

EAST SIDE OF COMMUNITY:				
162	illuminated address signs	@	\$125.00	= \$20,250.00
102	medium size lanterns	@	\$175.00	= \$17,850.00
WEST SIDE OF COMMUNITY:				
232	illuminated address signs	@	\$125.00	= \$29,000.00
273	medium size lanterns	@	\$175.00	= \$47,775.00
19	step illumination fixtures	@	\$425.00	= \$8,075.00
6	decorative "wharf" fixtures (arches)	@	\$400.00	= \$2,400.00
			TOTAL	= <u>\$125,350.00</u>

Per the association, we have excluded budgeting for the "exclusive use" lighting located at the front doors, patios and balconies; these lights are the maintenance responsibility of the individual unit owners.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Lighting - Streets / Parking

Category	050 Lighting	Quantity	13 pole lights
Photos	March 2021	Unit Cost	\$2,900.00
		% of Replacement	100.00%
		Current Cost	\$37,700.00
Placed In Service	06/15	Future Cost	\$66,525.82
Useful Life	30		
		Assigned Reserves at FYB	\$8,389.58
Remaining Life	23	Monthly Member Contribution	\$132.83
Replacement Year	2045	Monthly Interest Contribution	\$8.00
		Total Monthly Contribution	\$140.83

Comments:



These are the approximately 15' decorative metal poles with large vapor lanterns:

east side of community	5 pole lights
west side of community	8
	13 pole lights

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Lighting - Walkways

Category	050 Lighting	Quantity	7 bollards
Photos	March 2021	Unit Cost	\$2,250.00
		% of Replacement	100.00%
		Current Cost	\$15,750.00
Placed In Service	06/15	Future Cost	\$21,711.55
Useful Life	20		
		Assigned Reserves at FYB	\$5,294.68
Remaining Life	13	Monthly Member Contribution	\$78.73
Replacement Year	2035	Monthly Interest Contribution	\$5.02
		Total Monthly Contribution	\$83.75

Comments:



These are the metal bollard light fixtures located along walkways throughout the community:

west side of community	4 bollards
east side of community	3
	7 bollards



# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Decks, Civil Code 5551

Category	060 Buildings	Quantity	1 provision
Photos	March 2021	Unit Cost	\$11,000.00
		% of Replacement	100.00%
		Current Cost	\$11,000.00
Placed In Service	06/15	Future Cost	\$11,556.88
Useful Life	9		
		Assigned Reserves at FYB	\$8,436.89
Remaining Life	2	Monthly Member Contribution	\$116.91
Replacement Year	2024	Monthly Interest Contribution	\$7.97
		Total Monthly Contribution	\$124.89

Comments:



California Civil Code 5551, which went into effect January 1, 2020, requires condominium associations with three or more units to perform an inspection of certain "exterior elevated elements." Primarily this includes balconies, decks, stairways, walkways and railings that are supported by wood or wood-based products and are more than six feet above the ground.

The first inspection must be completed by the end of 2024 and subsequent inspections must be completed on a 9-year (maximum) cycle. Inspections must be performed by a licensed structural engineer or architect.

Inspections must confirm that areas are in a "generally safe condition" and "performing in accordance with applicable standards." If the inspector sees signs that the waterproofing system has been compromised, or that there is risk of damage to the load bearing components of the building, they are to use best judgment to recommend further inspections. The inspector must issue a written report that includes information about condition and recommended repairs.

Once the association has completed this inspection, if repairs are recommended, the association should immediately go out to bid for the recommended repairs. These bids should be provided to the reserve study preparer for inclusion into the reserve study unless another funding source, such as special assessment or loan, will be used.

At this time, the cost of this inspection and report is unknown. For the purposes of this analysis, we have included this component with a reasonable estimate of cost and timing. It is recommended that the association go out to bid

# Sample Condominium Association

## Component Detail

### Directed Cash Flow Calculation Method; Sorted by Category

immediately for this service and provide this information along with the likely timing to us so that this component can be modified as required.

#### Buildings - Decks, Coated (Resurface)

Category	060 Buildings	Quantity	5,712 sq. ft.
Photos	March 2021	Unit Cost	\$19.000
		% of Replacement	100.00%
		Current Cost	\$108,528.00
Placed In Service	06/15	Future Cost	\$132,230.83
Useful Life	15		
		Assigned Reserves at FYB	\$48,992.64
Remaining Life	8	Monthly Member Contribution	\$705.63
Replacement Year	2030	Monthly Interest Contribution	\$46.42
		Total Monthly Contribution	\$752.05

Comments:



These are the decks with a deck coating located throughout the community.

This component budgets for the longer-term repair and complete resurfacing of these deck surfaces.

\* During our March 2021 site visit, we were unable to access the decks.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Decks, Coated (Top Coat)

Category	060 Buildings	Quantity	5,712 sq. ft.
Photos	March 2021	Unit Cost	\$5.567
		% of Replacement	100.00%
		Current Cost	\$31,796.42
Placed In Service	05/21	Future Cost	\$35,097.30
Useful Life	5		
		Assigned Reserves at FYB	\$4,542.35
Remaining Life	4	Monthly Member Contribution	\$582.53
Replacement Year	2026	Monthly Interest Contribution	\$6.86
		Total Monthly Contribution	\$589.39

Comments:



These are the decks with a deck coating located throughout the community.

The association intends to top coat the decks in May 2021 for a total cost of \$31,253.

The current cost used for this component is based on actual expenditures incurred at last replacement, and has been adjusted for inflation where applicable.

This component budgets for the shorter-term repair, cleaning and top-coating of these deck surfaces.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Decks, Wood

Category	060 Buildings	Quantity	4,032 sq. ft.
Photos	March 2021	Unit Cost	\$55.000
		% of Replacement	100.00%
		Current Cost	\$221,760.00
Placed In Service	06/15	Future Cost	\$391,320.07
Useful Life	30		
		Assigned Reserves at FYB	\$49,349.41
Remaining Life	23	Monthly Member Contribution	\$781.32
Replacement Year	2045	Monthly Interest Contribution	\$47.10
		Total Monthly Contribution	\$828.42

Comments:



These are the wood decks located throughout the community.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Doors, Garage

Category	060 Buildings	Quantity	197 doors
Photos	March 2021	Unit Cost	\$1,250.000
		% of Replacement	100.00%
		Current Cost	\$246,250.00
Placed In Service	06/15	Future Cost	\$384,065.96
Useful Life	25		
		Assigned Reserves at FYB	\$65,944.92
Remaining Life	18	Monthly Member Contribution	\$1,011.95
Replacement Year	2040	Monthly Interest Contribution	\$62.79
		Total Monthly Contribution	\$1,074.74

Comments:



These are 16' x 7' sectional metal garage doors:

east side of community	81	doors
west side of community	116	
	197	doors

**Sample Condominium Association**  
**Component Detail**  
 Directed Cash Flow Calculation Method; Sorted by Category

**Buildings - Doors, Unit Entry**

Category	060 Buildings	Quantity	255 doors
Photos	March 2021	Unit Cost	\$1,250.000
		% of Replacement	100.00%
		Current Cost	\$318,750.00
Placed In Service	06/15	Future Cost	\$497,141.22
Useful Life	25		
		Assigned Reserves at FYB	\$85,360.17
Remaining Life	18	Monthly Member Contribution	\$1,309.89
Replacement Year	2040	Monthly Interest Contribution	\$81.27
		Total Monthly Contribution	\$1,391.15

Comments:



These are 3' x 8' decorative front entry and "alcove" doors:

east side of community	111 doors
west side of community	144
	<hr style="width: 100px; margin-left: auto; margin-right: 0;"/> 255 doors

Units with the "alcove" entrance have two front doors.

Some of these doors have "square" tops; some doors have "rounded" tops.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Doors, Utility Closets

Category	060 Buildings	Quantity	1 total
Photos	March 2021	Unit Cost	\$187,800.00
		% of Replacement	100.00%
		Current Cost	\$187,800.00
Placed In Service	06/15	Future Cost	\$292,903.91
Useful Life	25		
		Assigned Reserves at FYB	\$50,292.20
Remaining Life	18	Monthly Member Contribution	\$771.76
Replacement Year	2040	Monthly Interest Contribution	\$47.88
		Total Monthly Contribution	\$819.64

Comments:



These metal utility closet doors each have a vent:

EAST SIDE OF COMMUNITY:			
21	- 2.5' x 6'8" doors	@	\$900.00 = \$18,900.00
42	- 3' x 6'8" doors	@	\$950.00 = \$39,900.00
WEST SIDE OF COMMUNITY:			
42	- 2.5' x 6'8" doors	@	\$900.00 = \$37,800.00
96	- 3' x 6'8" doors	@	\$950.00 = \$91,200.00
		TOTAL	= <u>\$187,800.00</u>

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Fire Alarm Control Panels

Category	060 Buildings	Quantity	41 panels
Photos	March 2021	Unit Cost	\$3,250.00
		% of Replacement	100.00%
		Current Cost	\$133,250.00
Placed In Service	06/15	Future Cost	\$183,686.60
Useful Life	20		
		Assigned Reserves at FYB	\$44,794.68
Remaining Life	13	Monthly Member Contribution	\$666.05
Replacement Year	2035	Monthly Interest Contribution	\$42.54
		Total Monthly Contribution	\$708.59

Comments:



Each building has a "Mircom" fire alarm control panel:

east side of community	15 panels
west side of community	26
	41 panels

The association replaced a failed control panel in January 2019 for a total cost of \$950.



# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Metal Building Trim

Category	060 Buildings	Quantity	1 total
Photos	March 2021	Unit Cost	\$55,500.00
		% of Replacement	100.00%
		Current Cost	\$55,500.00
Placed In Service	06/15	Future Cost	\$97,935.89
Useful Life	30		
		Assigned Reserves at FYB	\$12,350.70
Remaining Life	23	Monthly Member Contribution	\$195.54
Replacement Year	2045	Monthly Interest Contribution	\$11.79
		Total Monthly Contribution	\$207.33

Comments:



The buildings have the following decorative wrought iron accents:

EAST SIDE OF COMMUNITY:			
15	- 1.5' x 1.5' trim pieces	@	\$250.00 = \$3,750.00
27	- 3' x 4.5' window grates	@	\$750.00 = \$20,250.00
WEST SIDE OF COMMUNITY:			
27	- 1.5' x 1.5' trim pieces	@	\$250.00 = \$6,750.00
33	- 3' x 4.5' window grates	@	\$750.00 = \$24,750.00
			TOTAL = \$55,500.00

# Sample Condominium Association

## Component Detail

### Directed Cash Flow Calculation Method; Sorted by Category

#### Buildings - Termite Control

Category	060 Buildings	Quantity	197 units
Photos	March 2021	Unit Cost	\$1,250.000
		% of Replacement	100.00%
		Current Cost	\$246,250.00
Placed In Service	06/15	Future Cost	\$300,031.71
Useful Life	15		
		Assigned Reserves at FYB	\$111,164.29
Remaining Life	8	Monthly Member Contribution	\$1,601.08
Replacement Year	2030	Monthly Interest Contribution	\$105.32
		Total Monthly Contribution	\$1,706.40

Comments:



Effective September 25, 1987, an amendment to Civil Code Section 1364 relating to responsibilities for the repair and maintenance of termite damage in various types of common interest developments was signed into California law as follows:

Section 1364(b):

(1) In a community apartment project, condominium project, or stock cooperative, as defined in Section 1351, unless otherwise provided in the declaration, the association is responsible for the repair and maintenance of the common area occasioned by the presence of wood-destroying pests or organisms.

(2) In a planned development, unless a different maintenance scheme is provided in the declaration, each owner of a separate interest is responsible for the repair and maintenance of that separate interest as may be occasioned by the presence of wood-destroying pests or organisms. Upon approval of the majority of all members of the association, the responsibility for such repair and maintenance may be delegated to the association, which shall be entitled to recover the cost thereof as a special assessment.

Section 1364(c):

The cost of temporary relocation during the repair and maintenance of the areas within the responsibility of the

# **Sample Condominium Association**

## **Component Detail**

### **Directed Cash Flow Calculation Method; Sorted by Category**

association shall be borne by the owner of the separate interest affected.

Please see the appropriate code sections for further details.

The consensus of pest control companies operating in this geographic area is that all buildings can be considered to warrant fumigation by 15 years of age. Additionally, it is recommended that each client provide a line item in their operating budget for "local treatments" annually which would include a provision for subterranean termites.

Due to the nature and size of this expense, it is appropriate to budget for "tenting" each building in the community on a 15 year cycle.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Buildings - Wood Shutters

Category	060 Buildings	Quantity	578 shutters
Photos	March 2021	Unit Cost	\$160.00
		% of Replacement	100.00%
		Current Cost	\$92,480.00
Placed In Service	06/15	Future Cost	\$127,484.70
Useful Life	20		
		Assigned Reserves at FYB	\$31,089.02
Remaining Life	13	Monthly Member Contribution	\$462.26
Replacement Year	2035	Monthly Interest Contribution	\$29.52
		Total Monthly Contribution	\$491.78

Comments:



These non-operable wood shutters measure from approximately 1.5' x 4' to 2' x 6' each.

The inventory for this component has been provided by the client in the form of the Department of Real Estate (DRE) reserve worksheets as originally prepared at the direction of the developer.

# Sample Condominium Association


## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Landscape - Irrigation Controller

Category	070 Landscape	Quantity	1 controller
Photos	March 2021	Unit Cost	\$15,000.00
		% of Replacement	100.00%
		Current Cost	\$15,000.00
Placed In Service	06/15	Future Cost	\$16,971.12
Useful Life	12		
		Assigned Reserves at FYB	\$8,525.18
Remaining Life	5	Monthly Member Contribution	\$120.45
Replacement Year	2027	Monthly Interest Contribution	\$8.06
		Total Monthly Contribution	\$128.51

Comments:

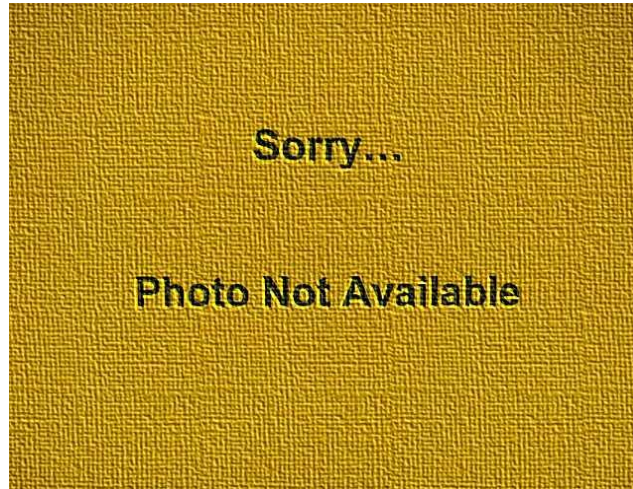

This is a "Rainbird" ESP-LXD 125 station irrigation controller.

The inventory for this component has been provided by the client's maintenance contractor.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Landscape - Renovation, Unfunded

Category	070 Landscape	Quantity	1 comment
Photos	March 2021	Unit Cost	\$0.00
		% of Replacement	0.00%
		Current Cost	\$0.00
Placed In Service	06/15	Future Cost	\$0.00
Useful Life	n.a.		
		Assigned Reserves at FYB	\$0.00
Remaining Life	n.a.	Monthly Member Contribution	\$0.00
Replacement Year	n.a.	Monthly Interest Contribution	\$0.00
		Total Monthly Contribution	\$0.00

Comments:



Major landscape renovation can be a major expense and significant potential liability to the client if not planned for in advance. However, landscape renovation can also be effectively managed as an annual operating/maintenance expense through time.

As the extent and nature of this liability is largely indeterminable, we have excluded budgeting for this component at this time. Should the client desire, budgeting for this component can be incorporated into this analysis.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Landscape - Tree Trimming

Category	070 Landscape	Quantity	1 provision
Photos	March 2021	Unit Cost	\$18,000.00
		% of Replacement	100.00%
		Current Cost	\$18,000.00
Placed In Service	01/20	Future Cost	\$18,911.25
Useful Life	2		
		Assigned Reserves at FYB	\$18,000.00
Remaining Life	0	Monthly Member Contribution	\$751.78
Replacement Year	2022	Monthly Interest Contribution	\$3.71
		Total Monthly Contribution	\$755.48

Comments:



The association spent the following on tree trimming:

- 2017: \$9,135
- 2018: \$12,440
- 2019: \$18,000
- 11/2019: \$10,505
- 10/2020: \$12,114
- 11/2021: \$13,000 projected

This component, and all information contained herein, has been provided by the client and incorporated into this analysis at their request.

The useful life estimate for this component has been provided by the client.

# Sample Condominium Association

## Component Detail

Directed Cash Flow Calculation Method; Sorted by Category

### Mailboxes

Category	080 Miscellaneous	Quantity	1 total
Photos	March 2021	Unit Cost	\$45,600.00
		% of Replacement	100.00%
		Current Cost	\$45,600.00
Placed In Service	06/15	Future Cost	\$71,120.44
Useful Life	25		
		Assigned Reserves at FYB	\$12,211.53
Remaining Life	18	Monthly Member Contribution	\$187.39
Replacement Year	2040	Monthly Interest Contribution	\$11.62
		Total Monthly Contribution	\$199.01

Comments:



These are the metal pedestal-mounted mailbox clusters located throughout the community:

EAST SIDE OF COMMUNITY:			
1 - 16 box cluster	@	\$2,400.00 =	\$2,400.00
5 - 24 box clusters	@	\$3,600.00 =	\$18,000.00
WEST SIDE OF COMMUNITY:			
3 - 16 box clusters	@	\$2,400.00 =	\$7,200.00
5 - 24 box clusters	@	\$3,600.00 =	\$18,000.00
		TOTAL =	<u>\$45,600.00</u>

Some of mailboxes have been combined to form parcel lockers or outgoing mailboxes.



**Sample Condominium Association**  
**Component Detail**  
**Directed Cash Flow Calculation Method; Sorted by Category**

**Metal Arches**

Category	080 Miscellaneous	Quantity	8 metal arches
Photos	March 2021	Unit Cost	\$4,000.00
		% of Replacement	100.00%
		Current Cost	\$32,000.00
Placed In Service	06/15	Future Cost	\$49,909.08
Useful Life	25		
		Assigned Reserves at FYB	\$8,569.49
Remaining Life	18	Monthly Member Contribution	\$131.50
Replacement Year	2040	Monthly Interest Contribution	\$8.15
		Total Monthly Contribution	\$139.66

Comments:



These are 11' x 9.5' decorative metal arches located throughout the community:

west side of community	6 arches
east side of community	2
	<hr style="width: 100px; margin-left: auto; margin-right: 0;"/> 8 arches

# Sample Condominium Association

## Detail Report Index

	<b>Page</b>
Buildings - Decks, Civil Code 5551	34
Buildings - Decks, Coated (Resurface)	35
Buildings - Decks, Coated (Top Coat)	36
Buildings - Decks, Wood	37
Buildings - Doors, Garage	38
Buildings - Doors, Unit Entry	39
Buildings - Doors, Utility Closets	40
Buildings - Fire Alarm Control Panels	41
Buildings - Metal Building Trim	42
Buildings - Termite Control	43
Buildings - Wood Shutters	45
Fencing - Aluminum	28
Landscape - Irrigation Controller	46
Landscape - Renovation, Unfunded	47
Landscape - Tree Trimming	48
Lighting - Buildings	31
Lighting - Streets / Parking	32
Lighting - Walkways	33
Mailboxes	49
Metal Arches	50
Painting - Aluminum Fencing	24
Painting - Miscellaneous Metal	25
Painting - Stucco	26
Painting - Woodwork & Trim	27
Railing - Wrought Iron	29
Roofing - Rain Gutters	22
Roofing - Tile	23
Streets - Asphalt, Overlay / Major Rehab	17
Streets - Asphalt, Repair	19
Streets - Asphalt, Seal Coat	20
Streets - Concrete, Unfunded	21
Walls - Stucco, Repair	30

Number of components included in this reserve analysis is 32.